



$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{tot.})$


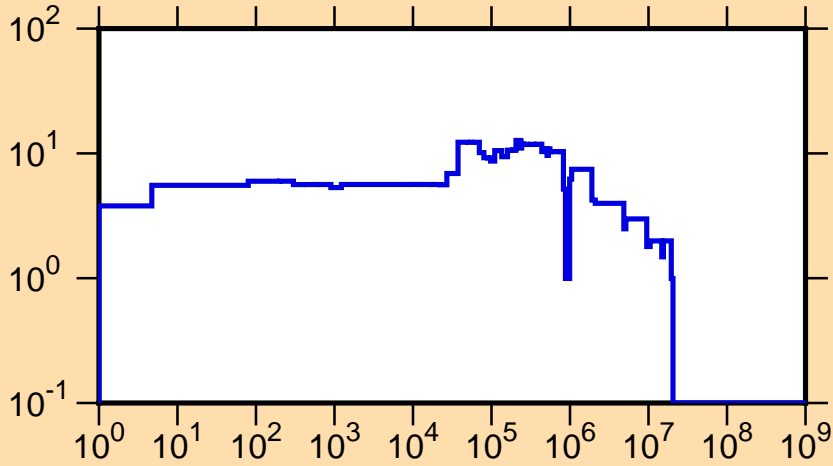


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

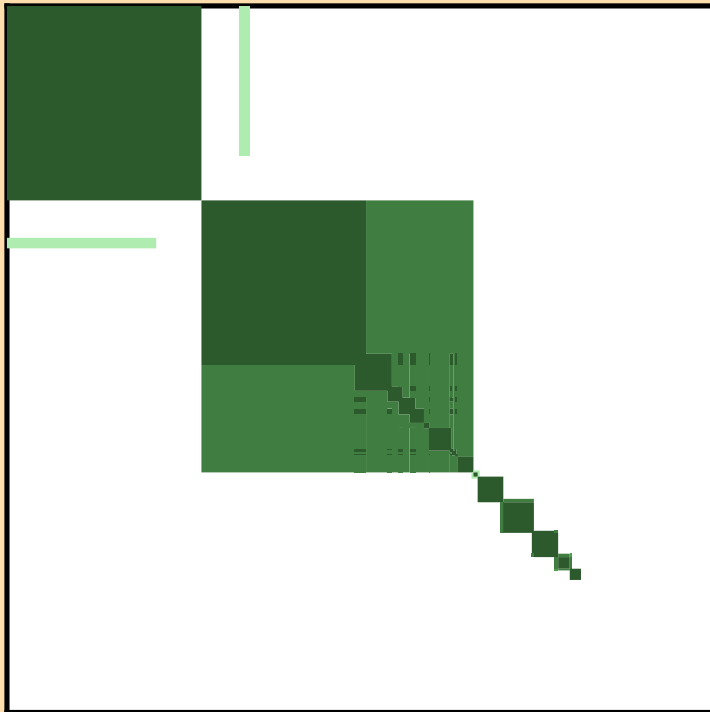

Correlation Matrix

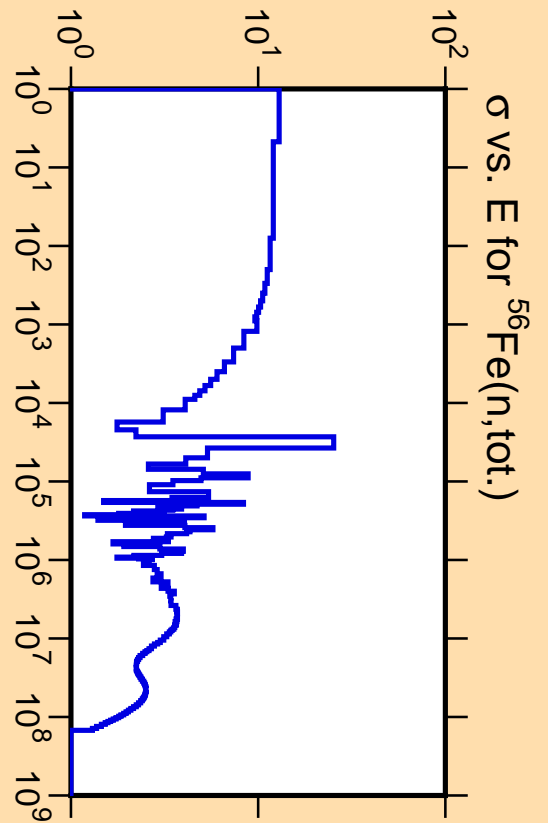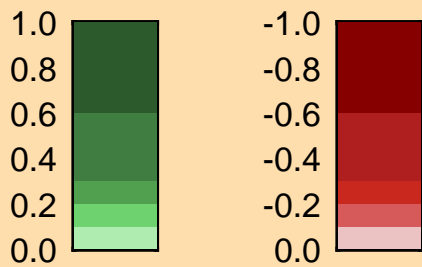


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{el.})$


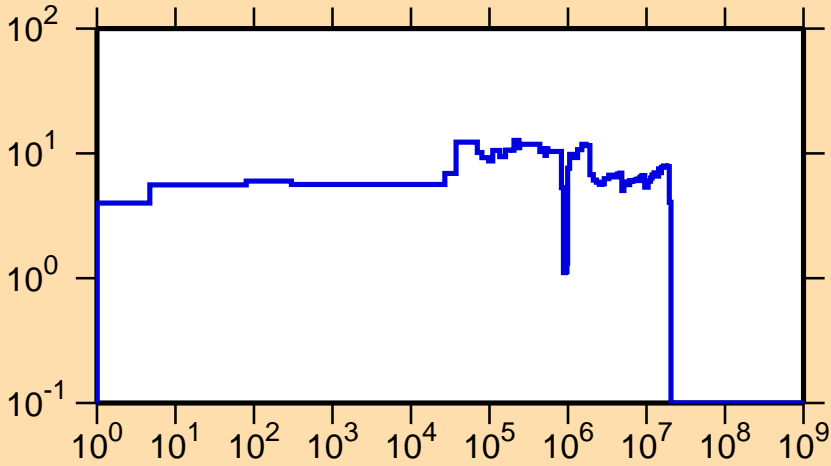


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

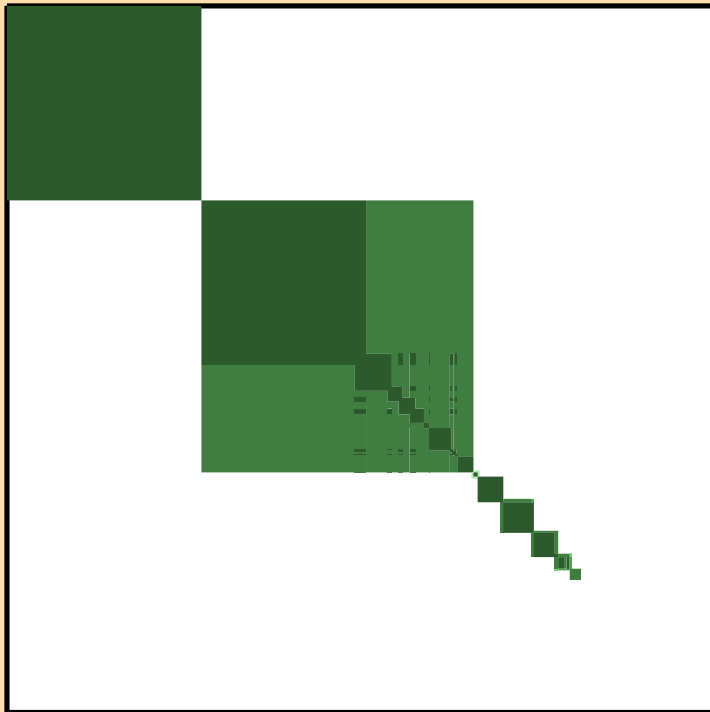

Correlation Matrix

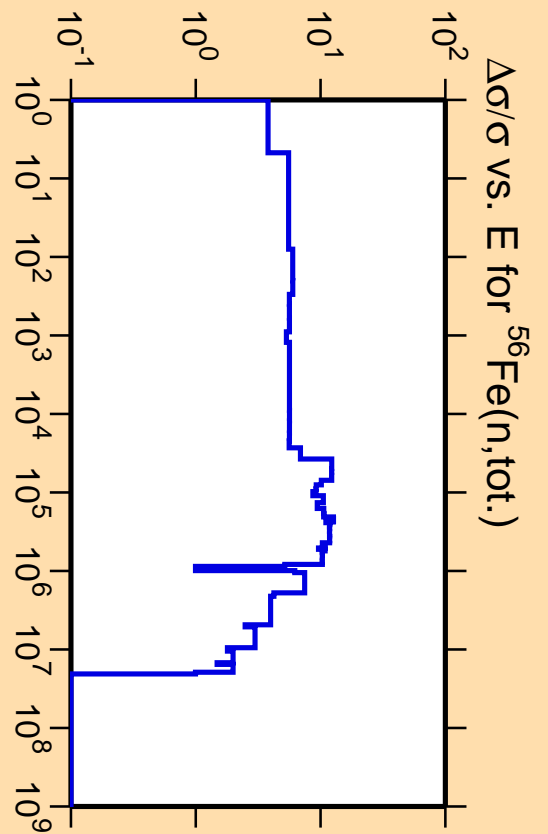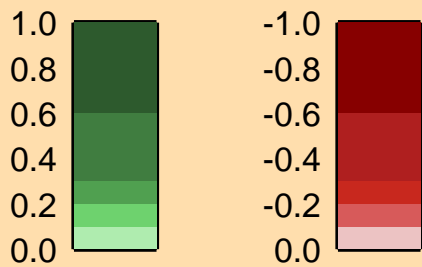


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{nonel.})$


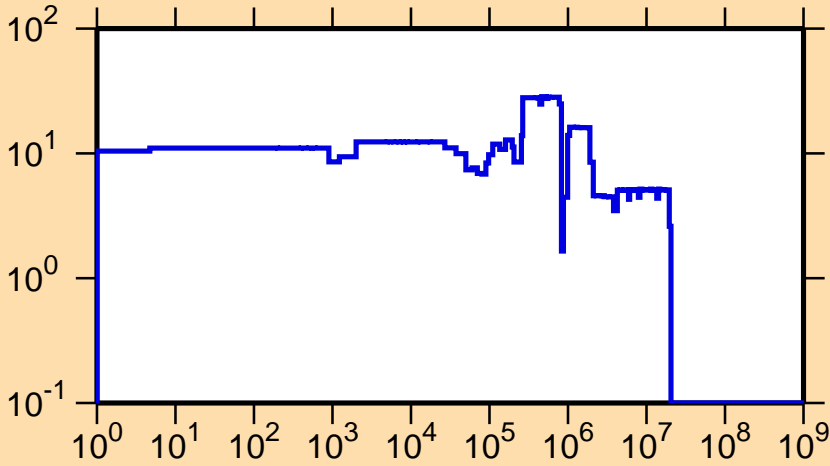


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

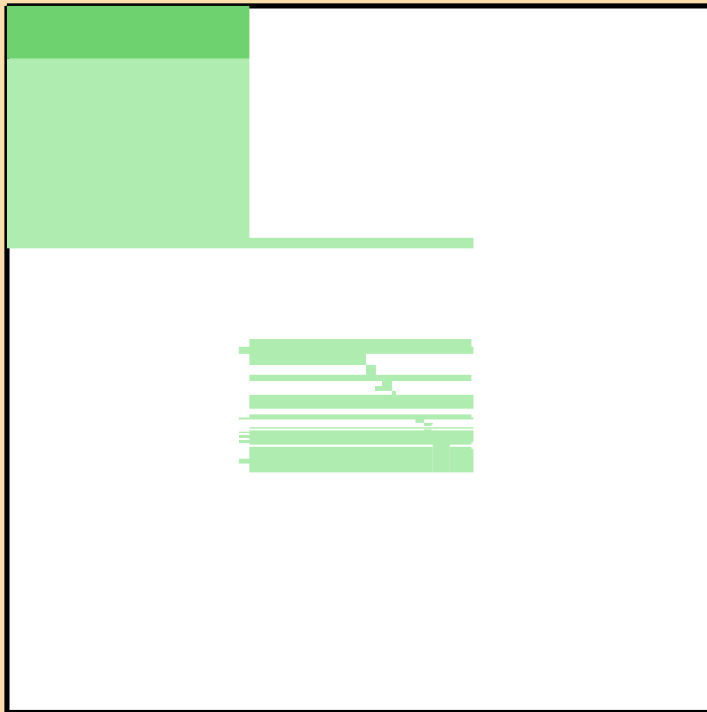

Correlation Matrix

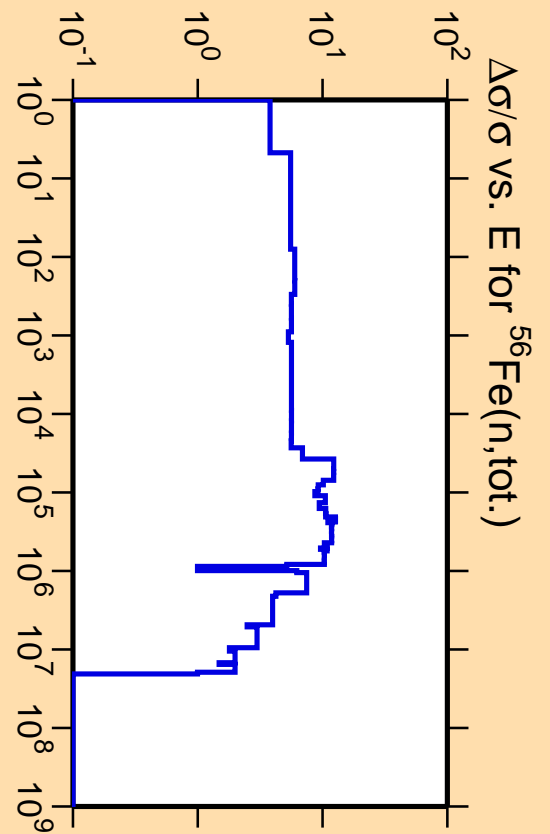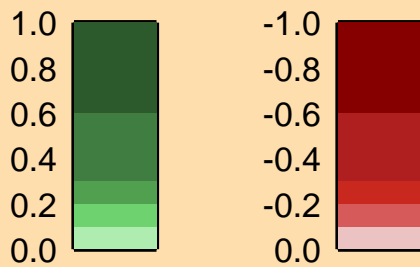


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\gamma)$

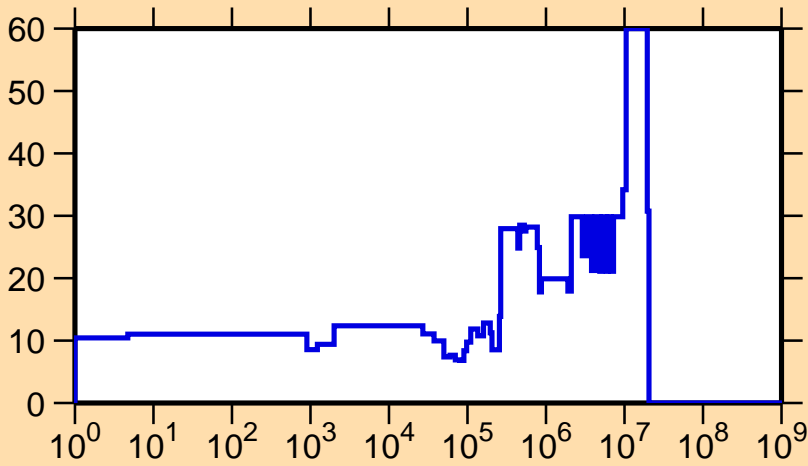



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

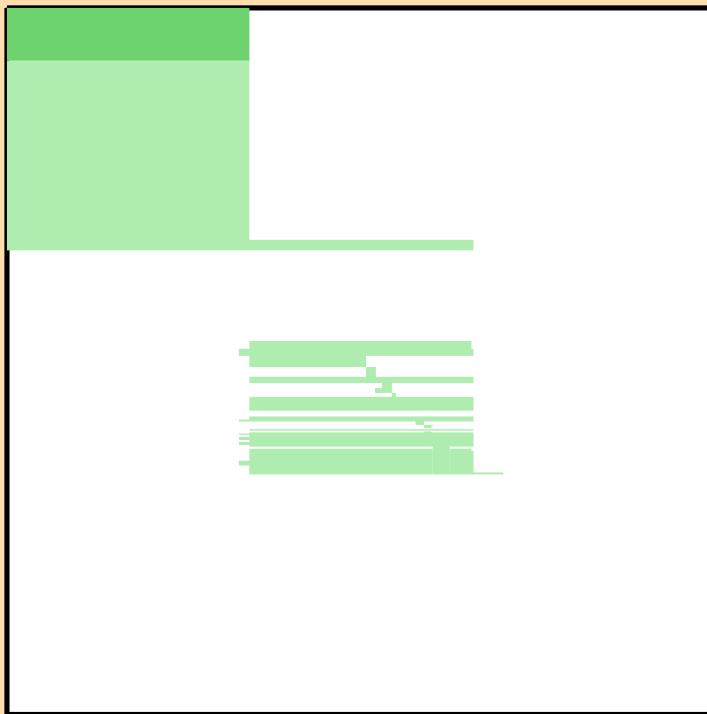


Correlation Matrix

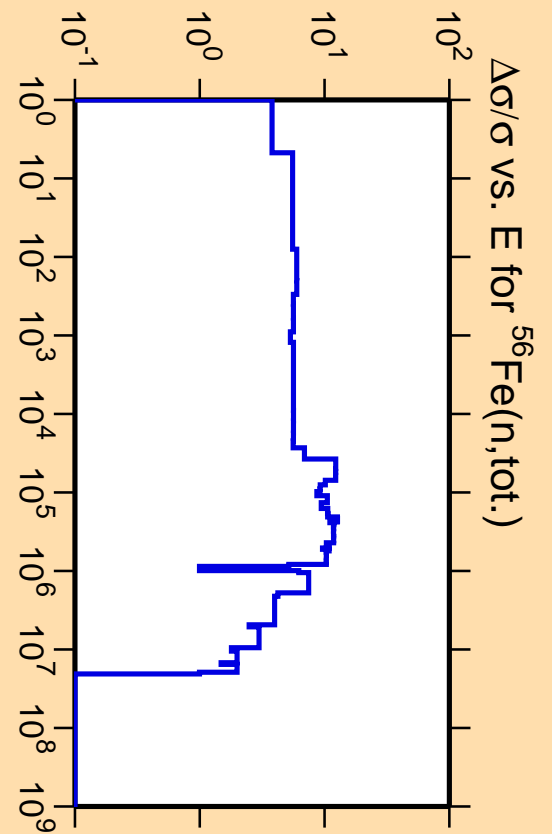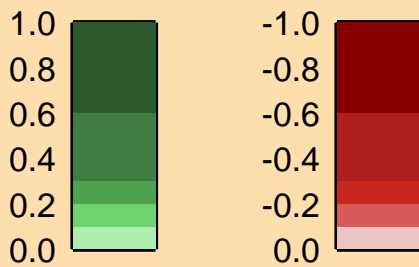


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{tot.})$

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{el.})$


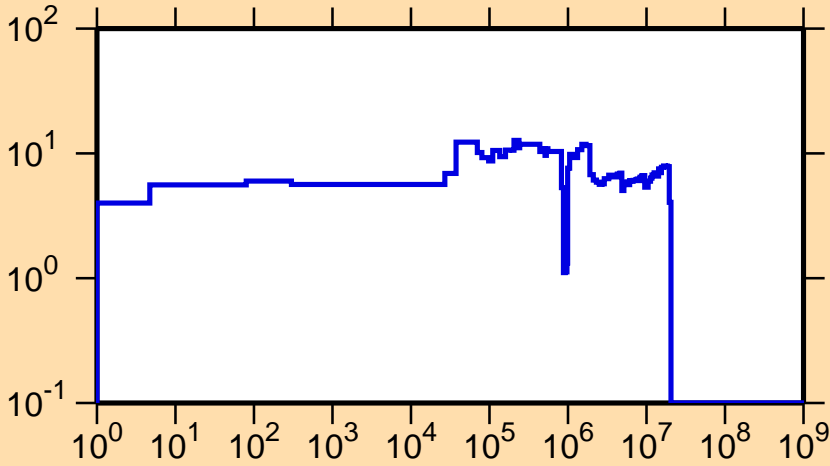


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

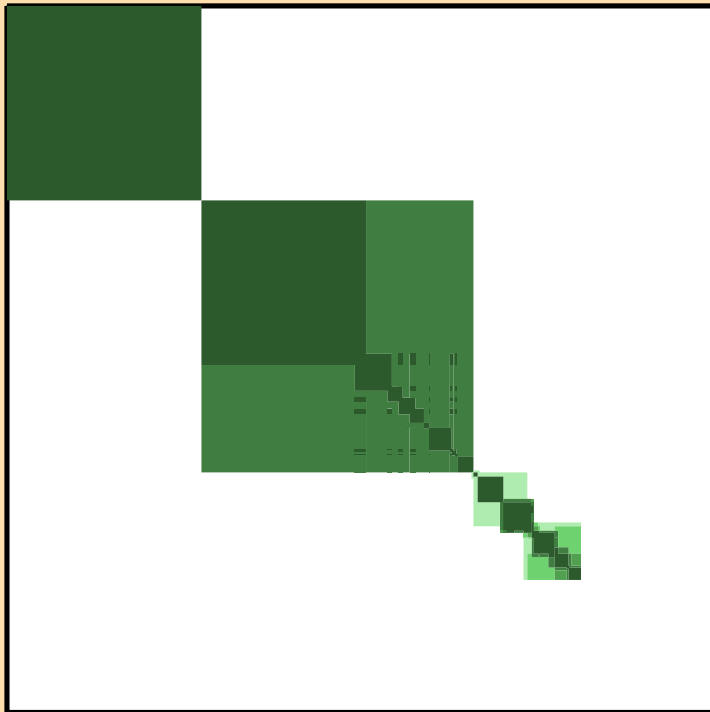


Correlation Matrix

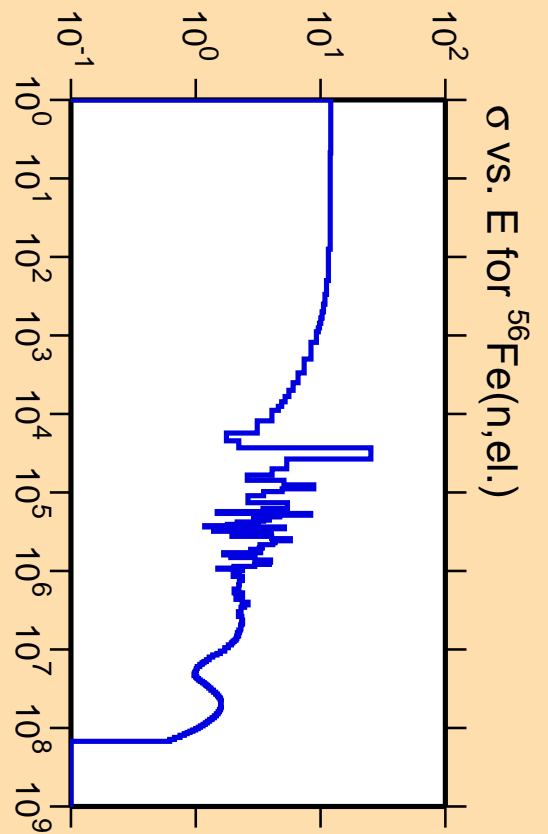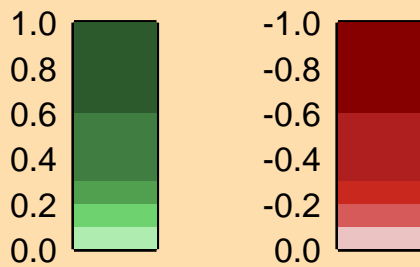


σ vs. E for $^{56}\text{Fe}(n,\text{el.})$

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{nonel.})$


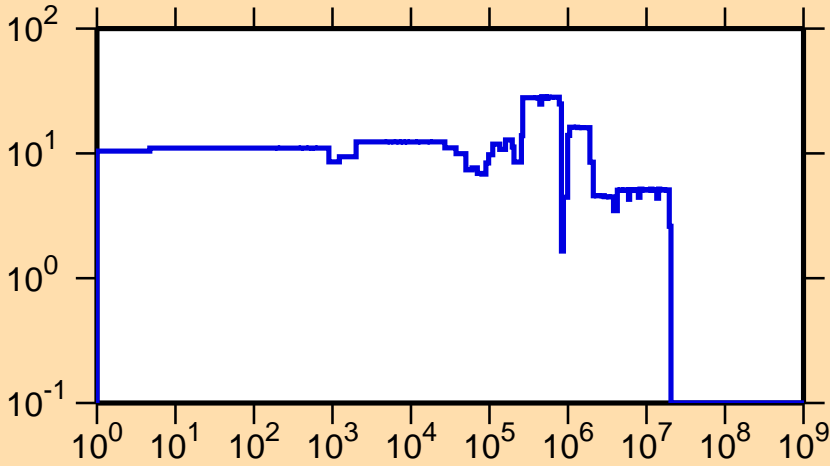


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

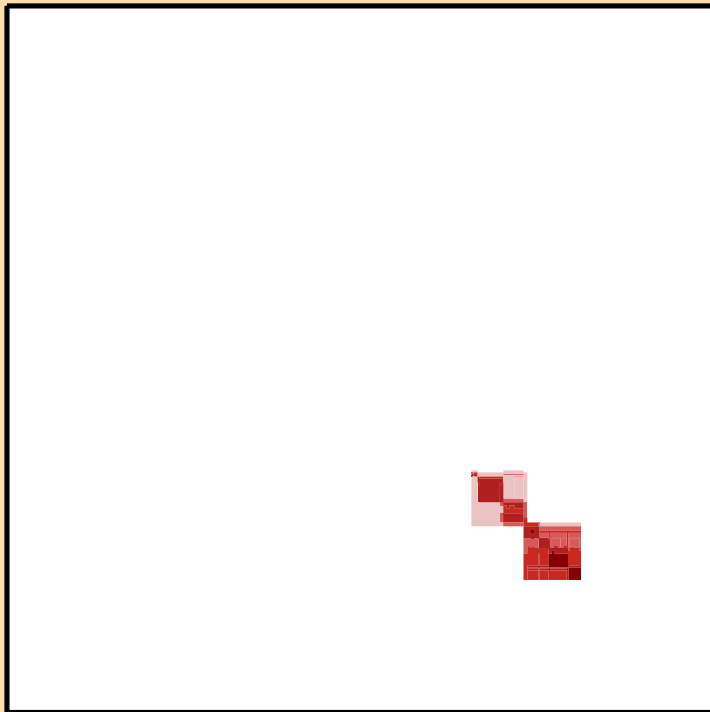

Correlation Matrix

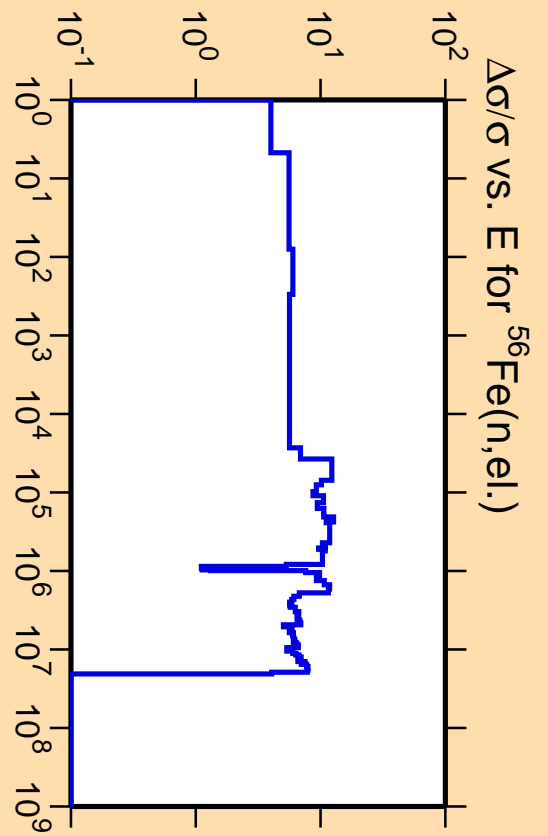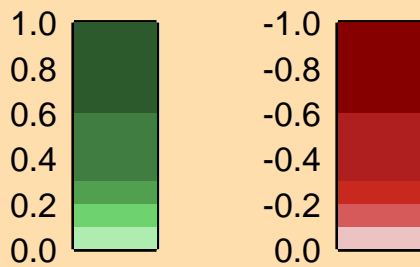


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{inel.})$


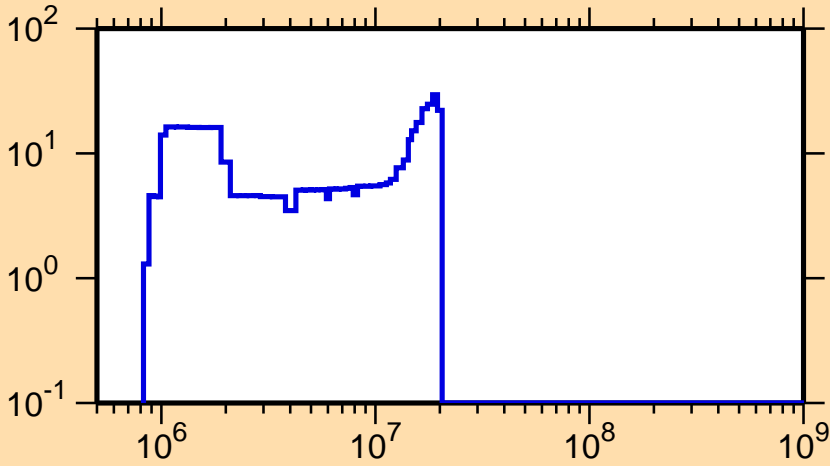


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

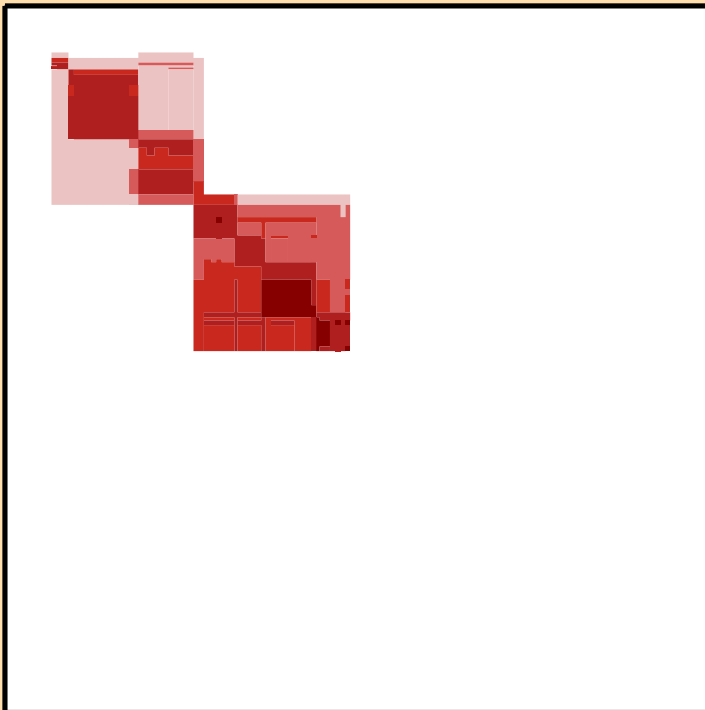

Correlation Matrix

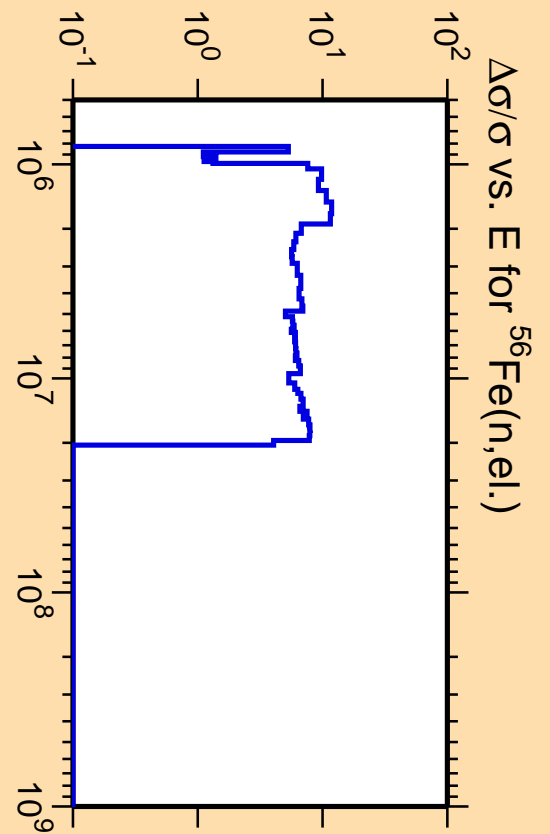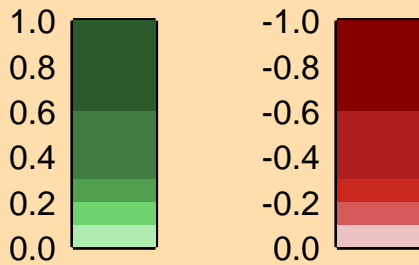


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{nonel.})$


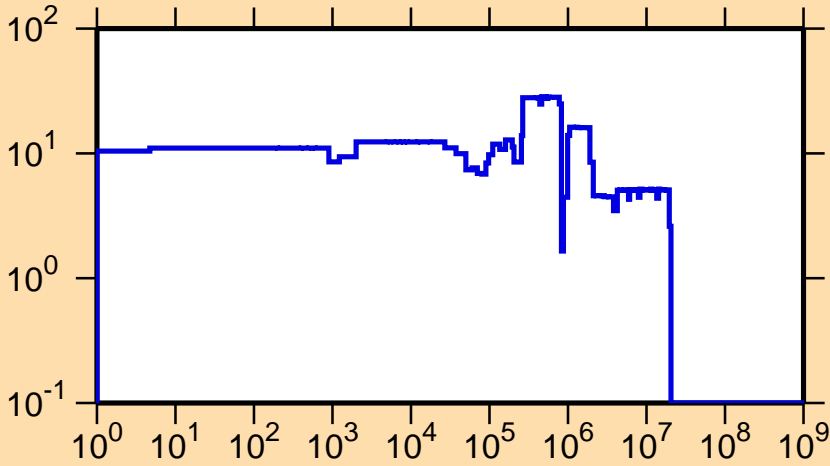


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

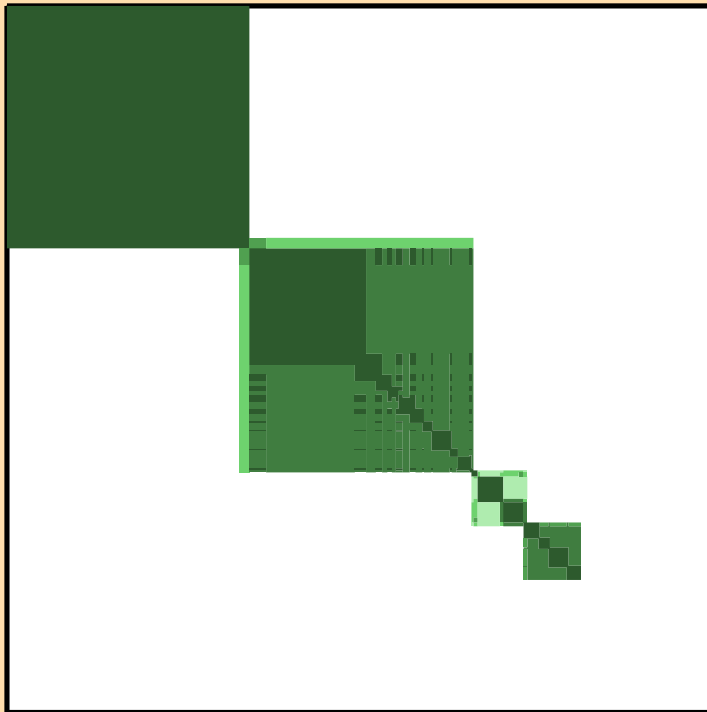


Correlation Matrix

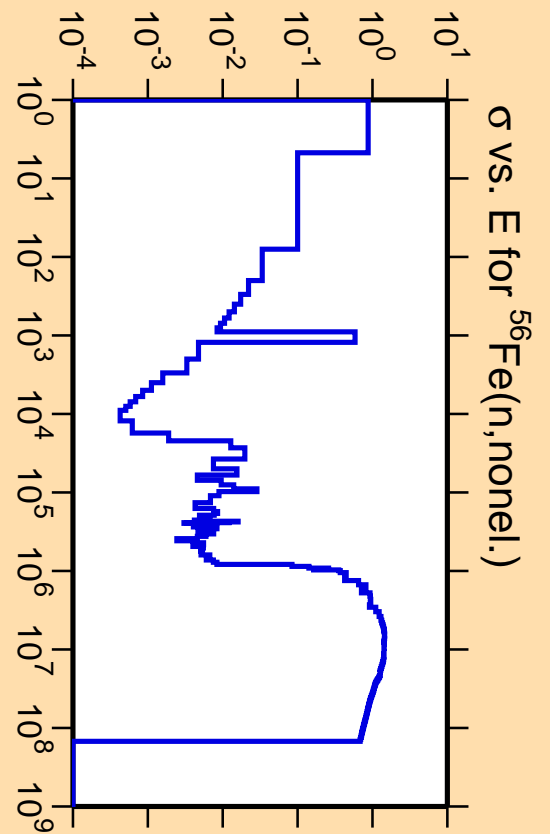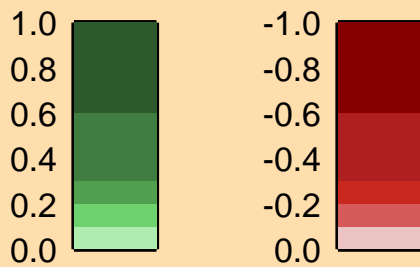

σ vs. E for $^{56}\text{Fe}(n,\text{nonel.})$

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{inel.})$


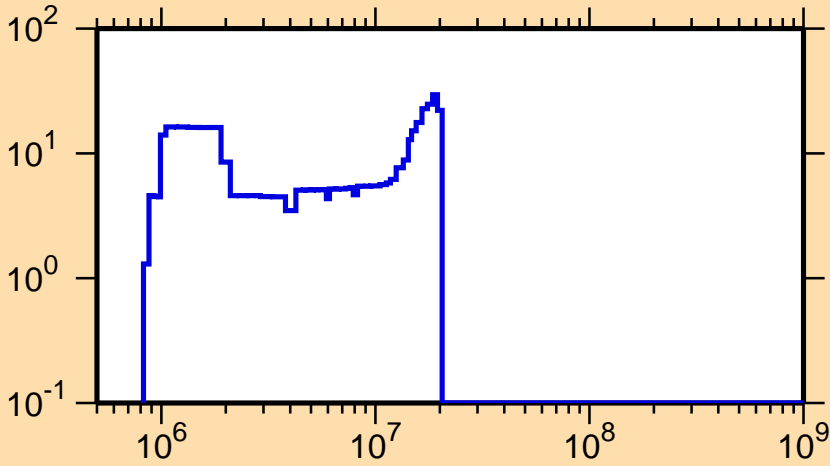


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).



Correlation Matrix

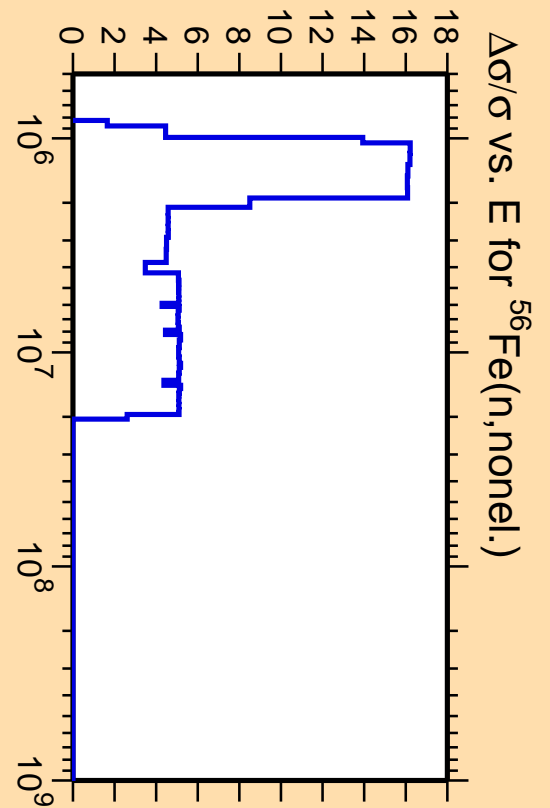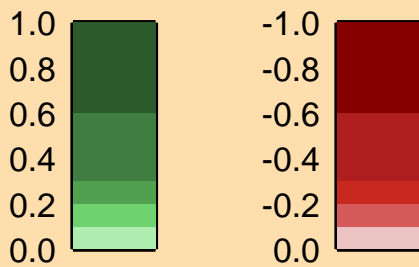


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\gamma)$

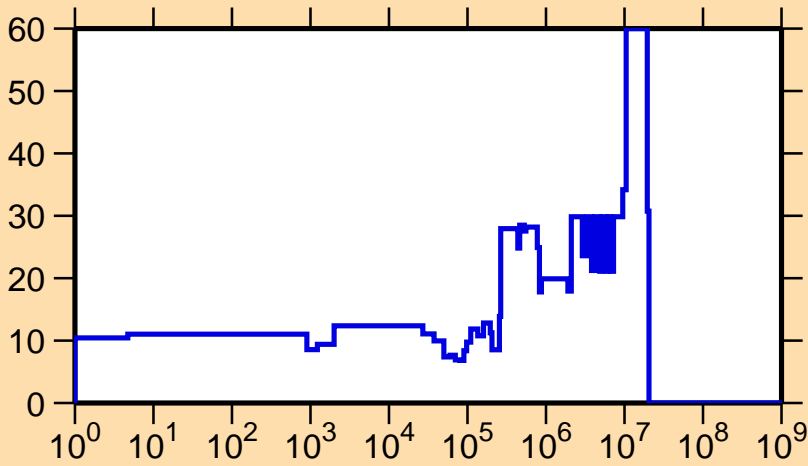



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

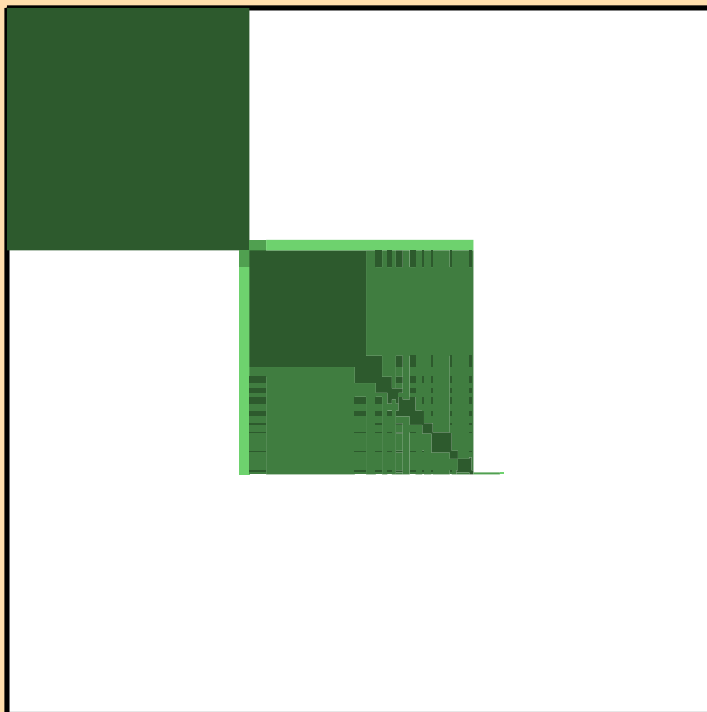

Correlation Matrix

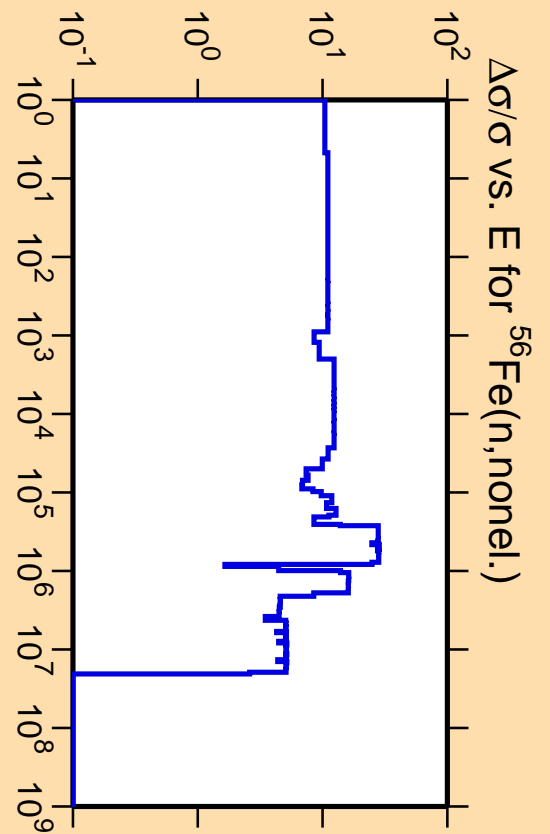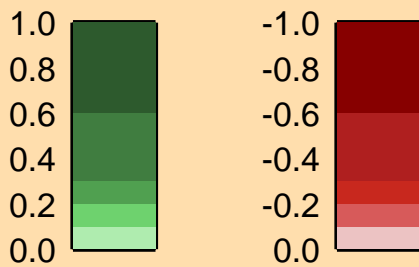


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{inel.})$


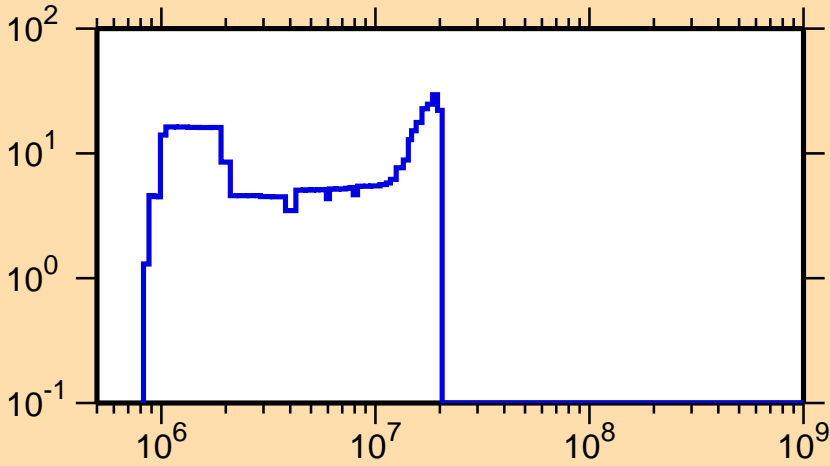


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

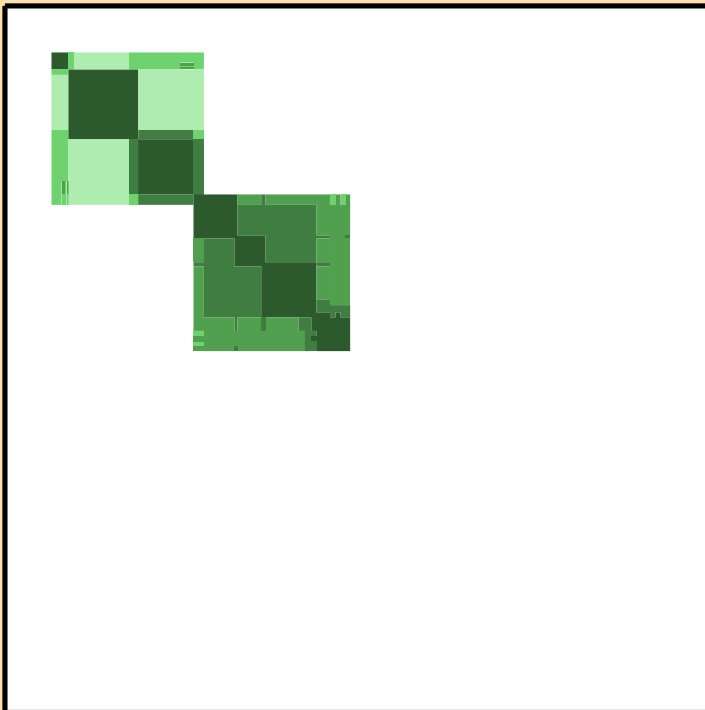


Correlation Matrix

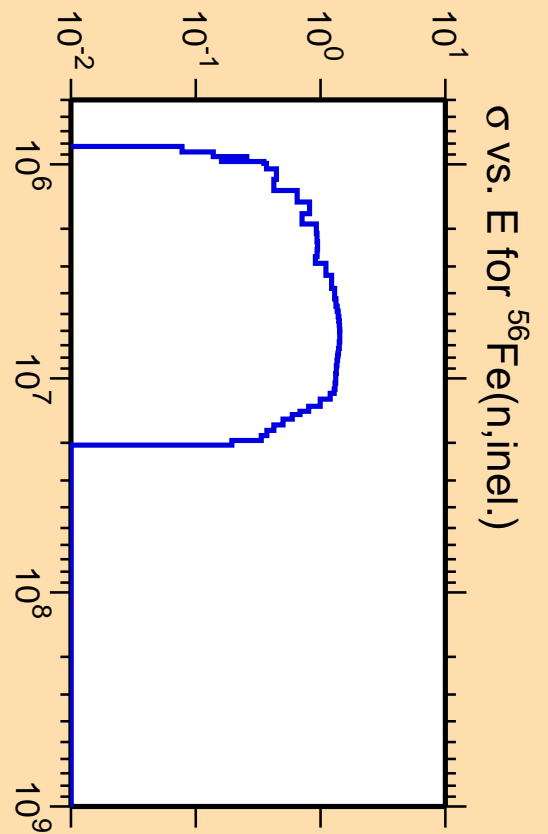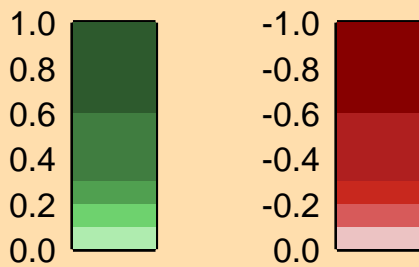


σ vs. E for $^{56}\text{Fe}(n,\text{inel.})$

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,2n)$


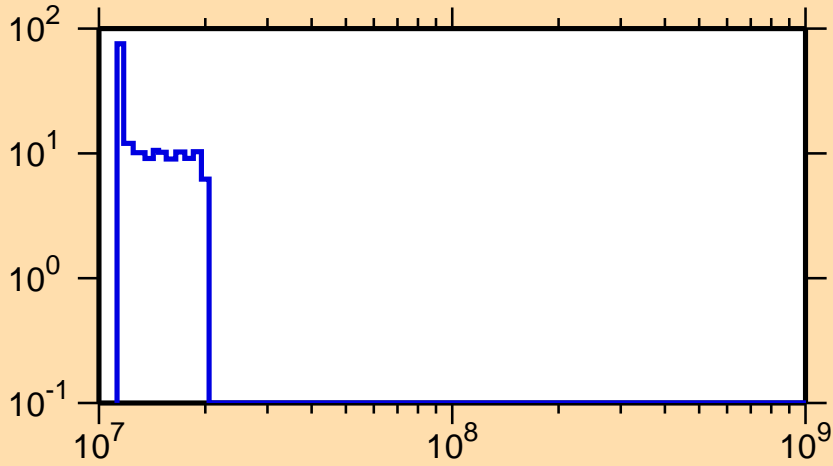


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).



Correlation Matrix

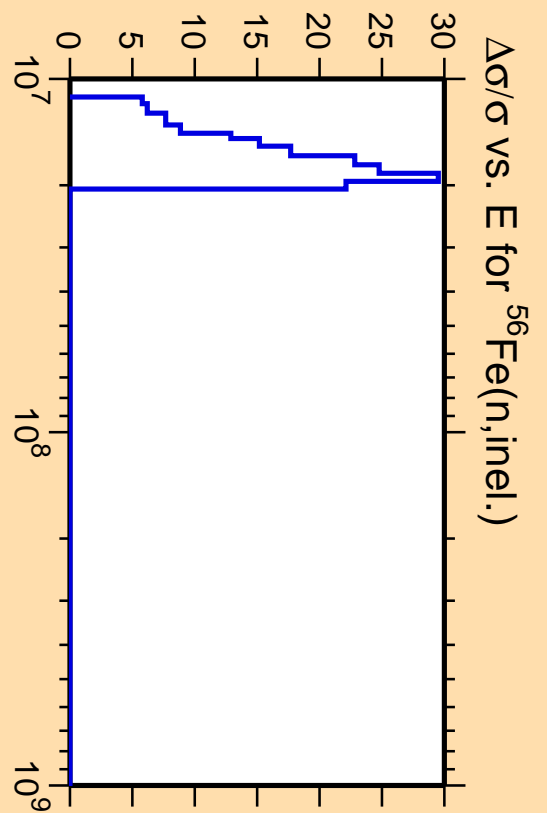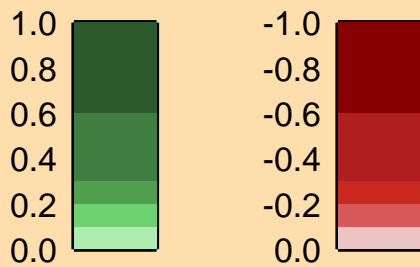


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n\alpha)$

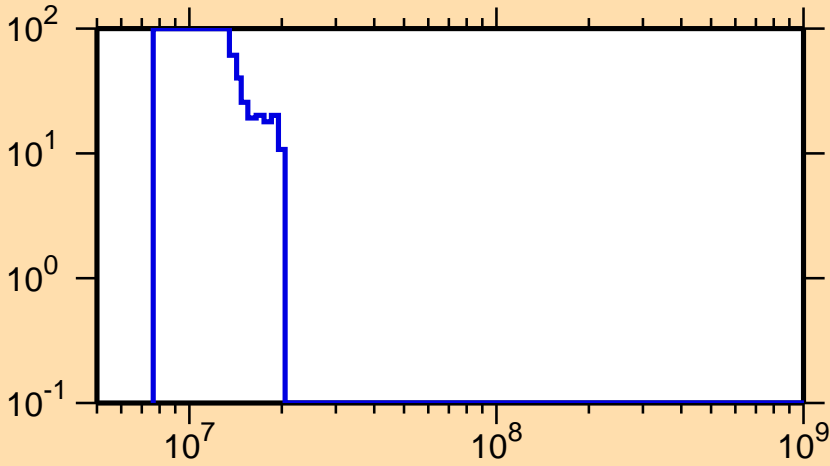



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

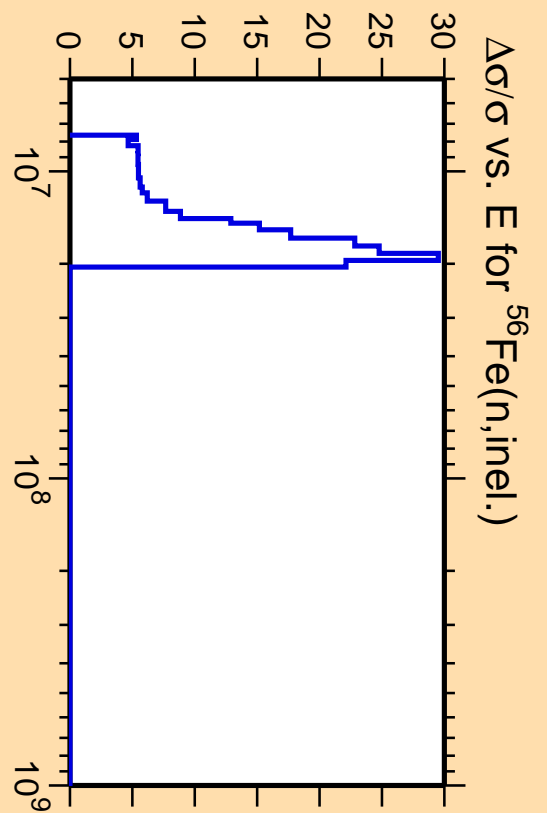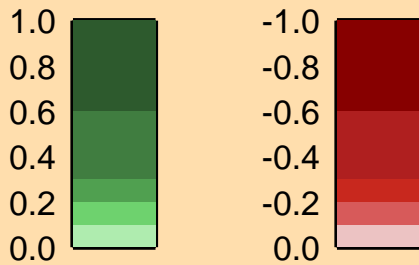


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,np)$

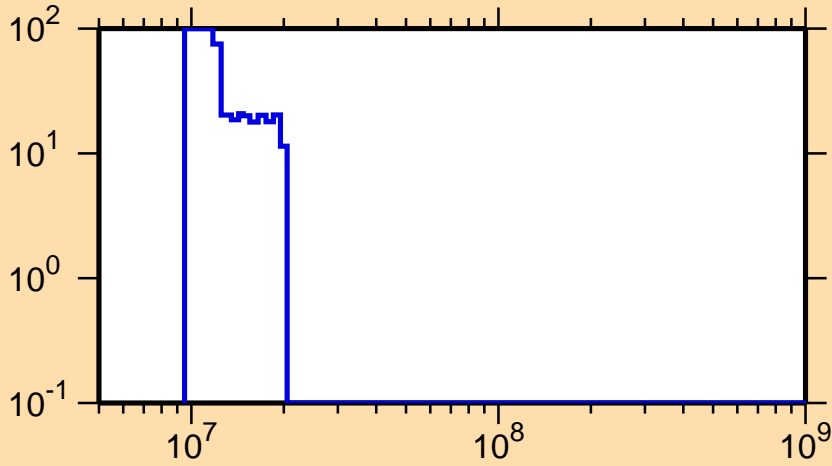



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

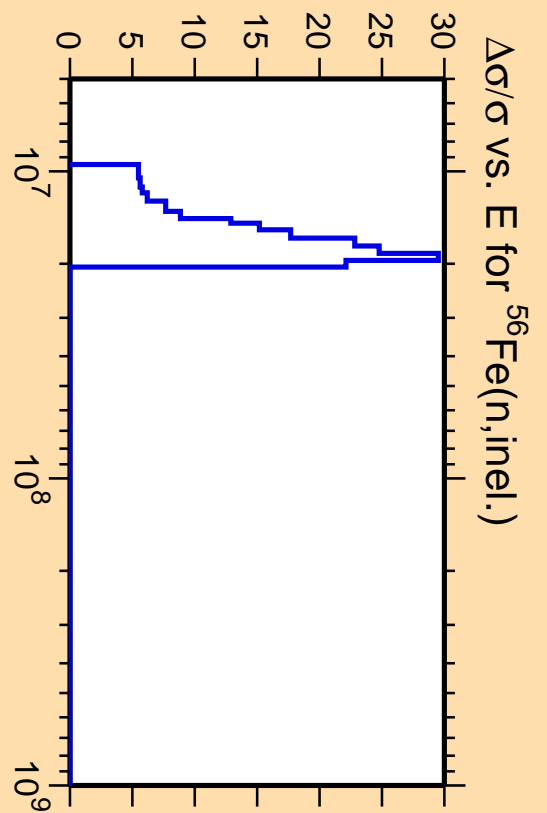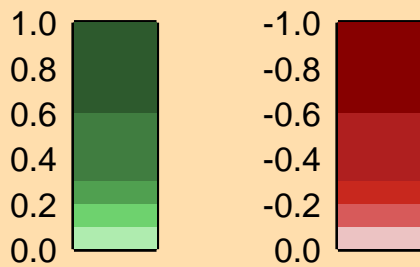


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\gamma)$

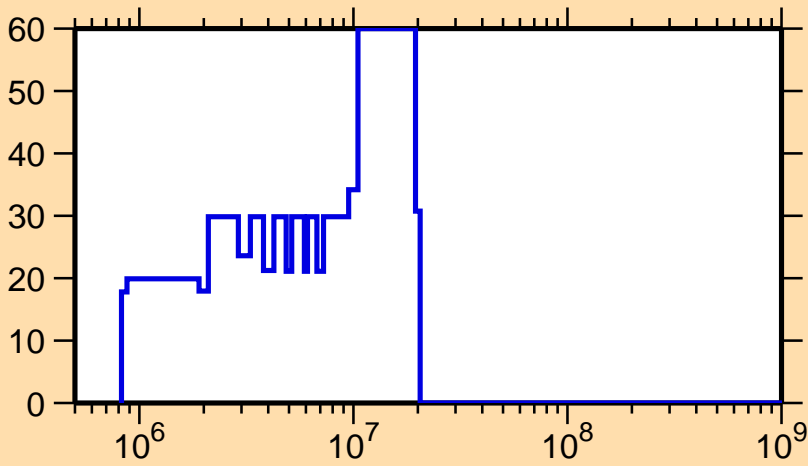



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

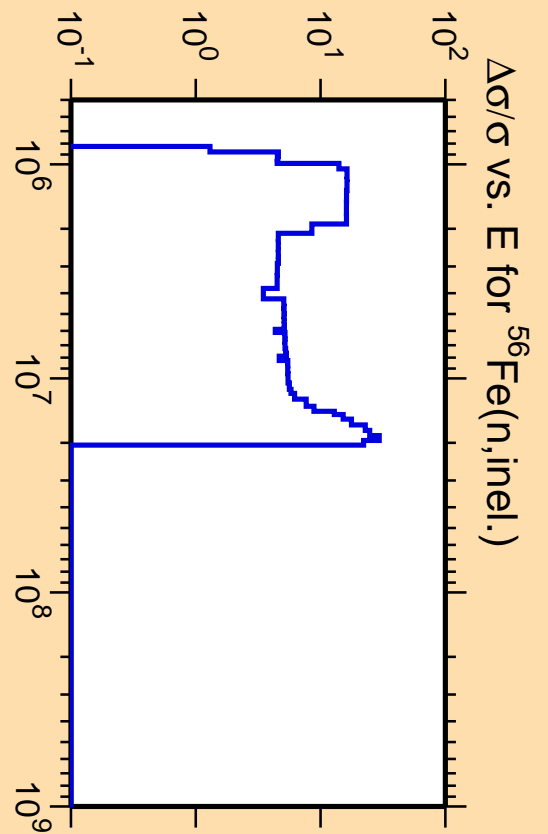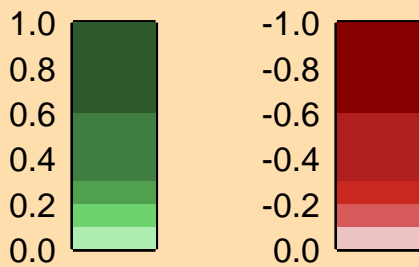


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,p)$


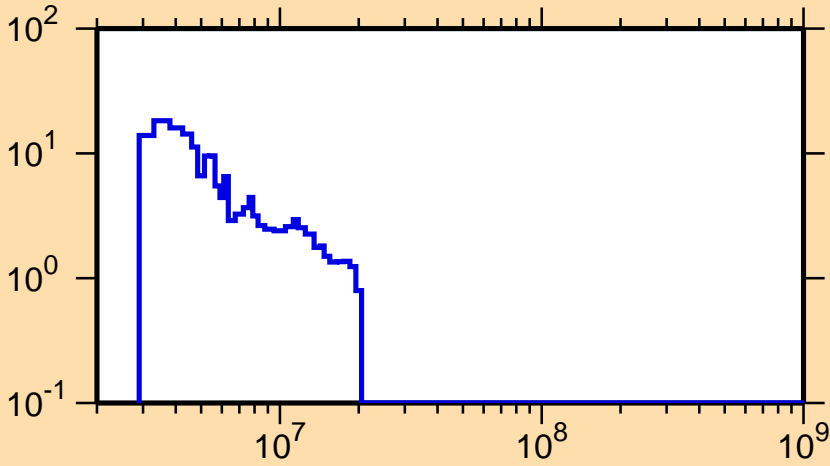


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).



Correlation Matrix

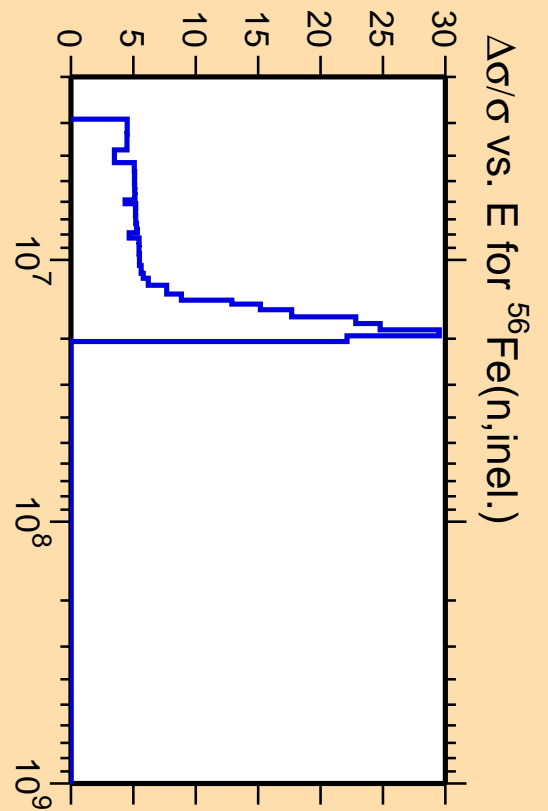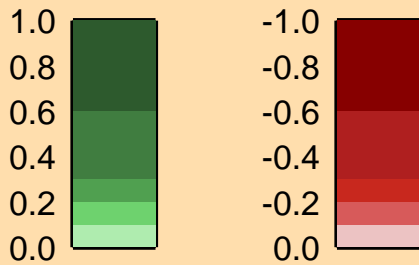


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,d)$

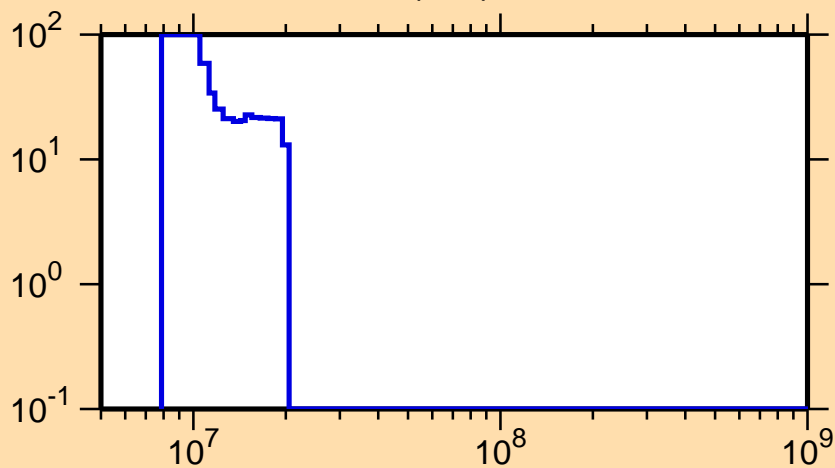



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

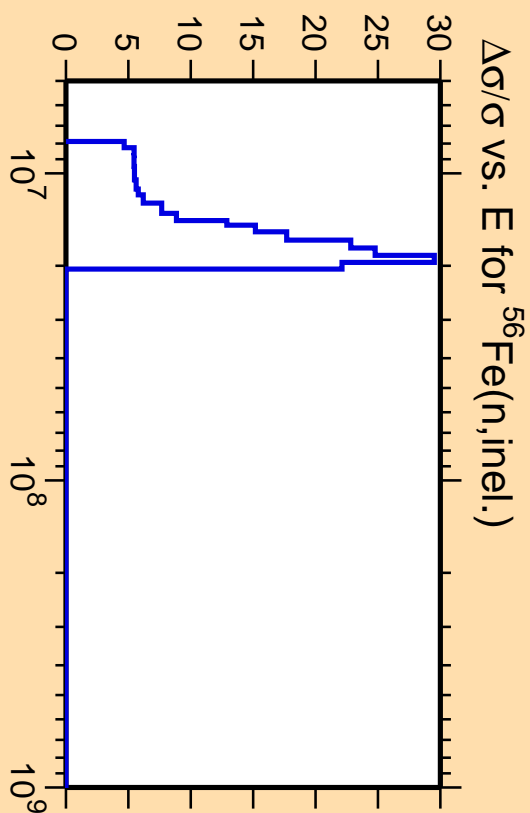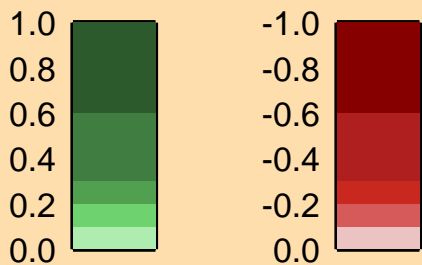


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,t)$

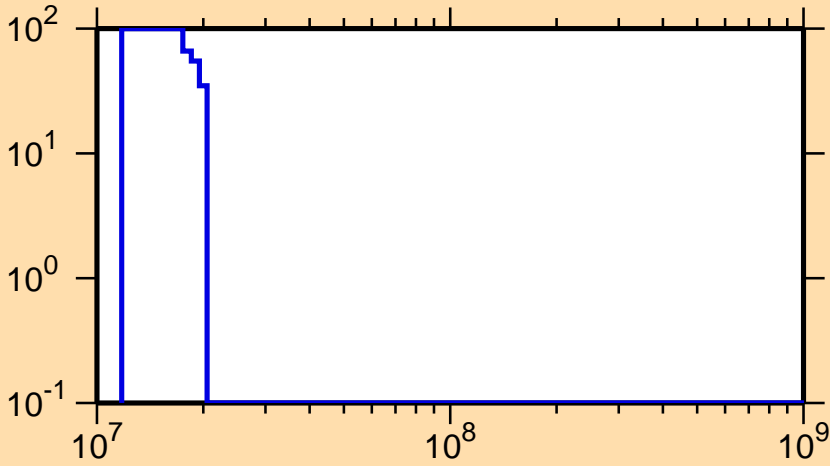



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

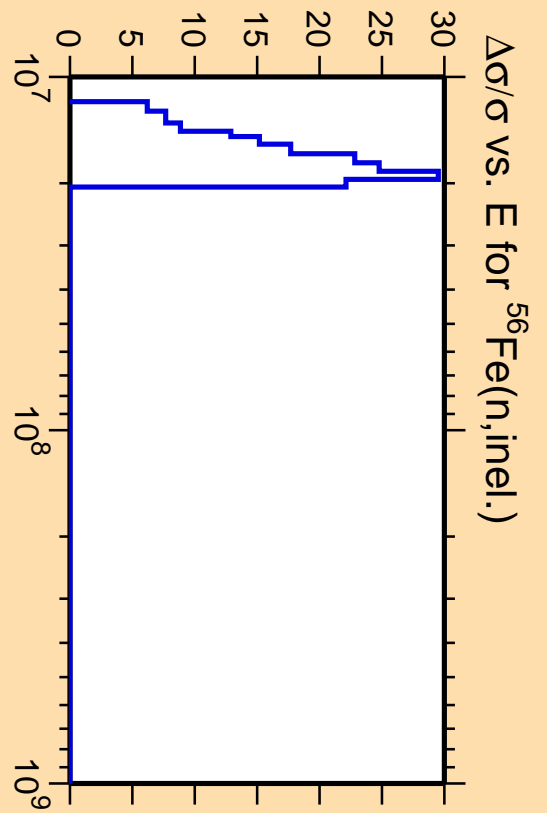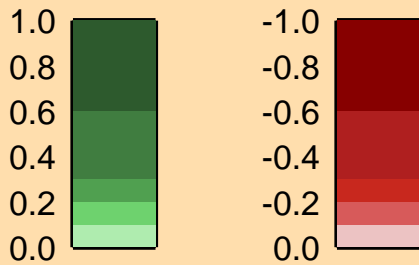


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{He}3)$

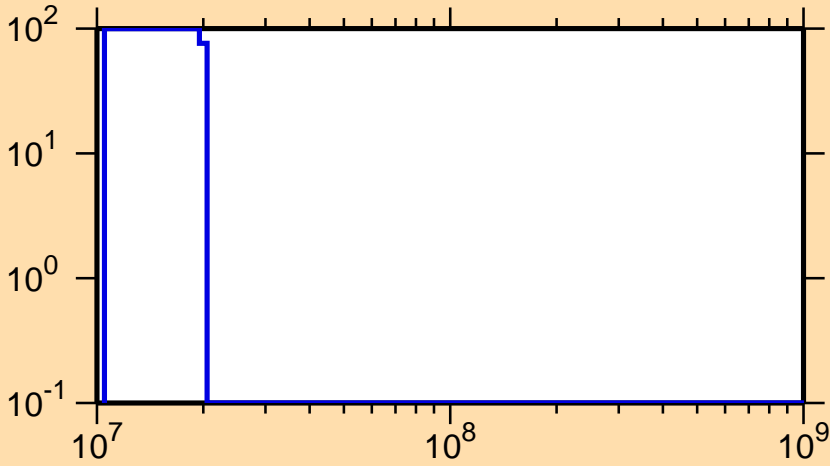



Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

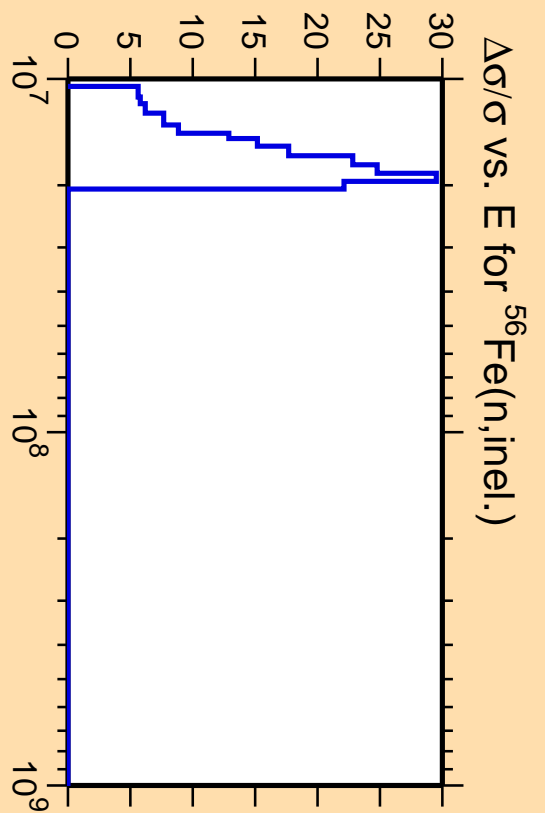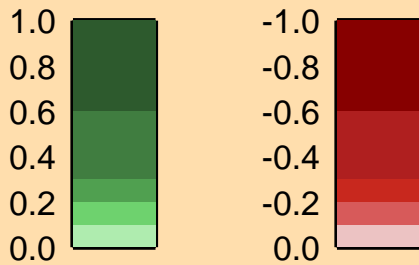


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\alpha)$


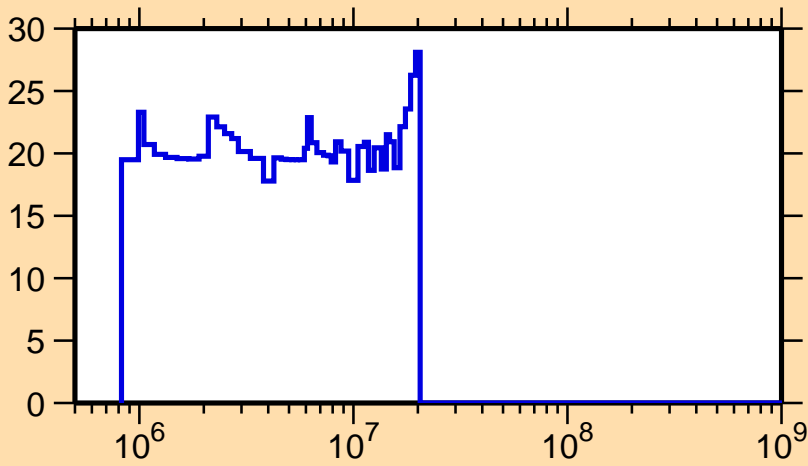


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).



Correlation Matrix

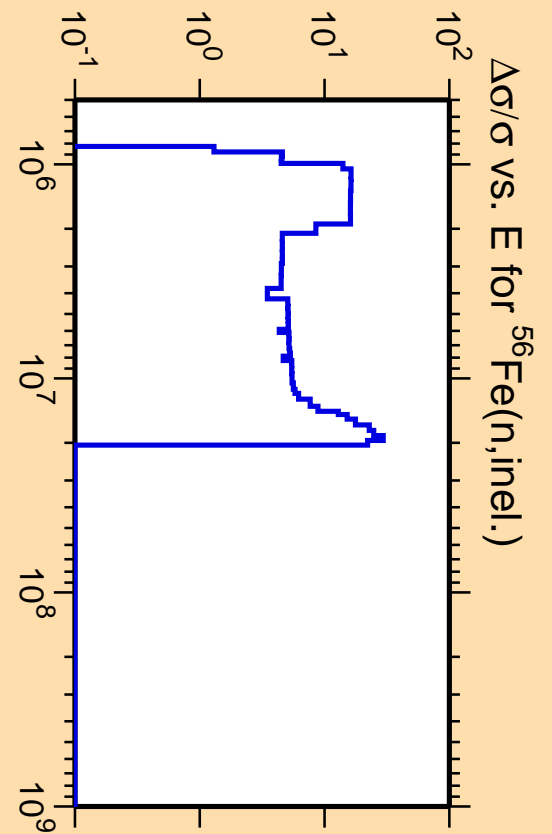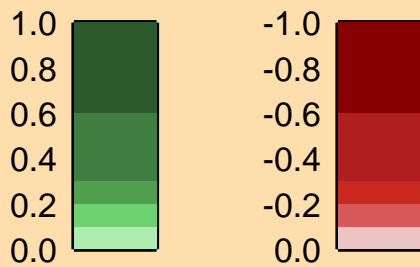

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,2n)$


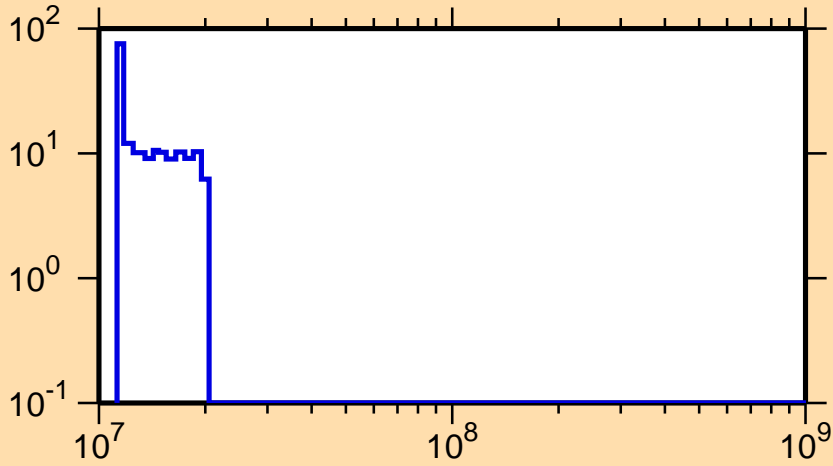


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

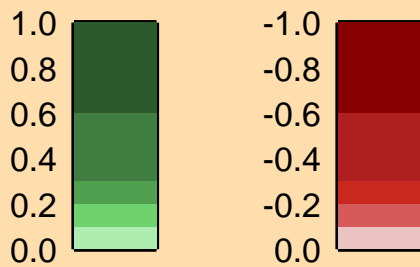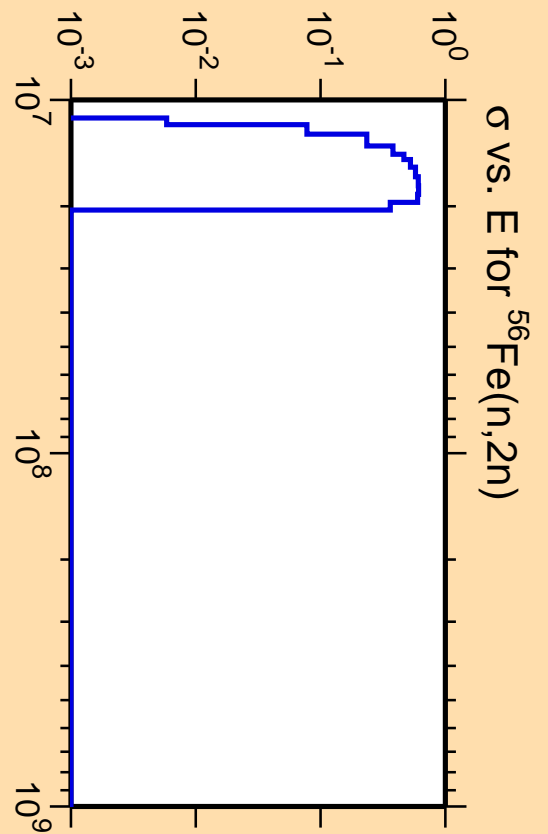


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n\alpha)$

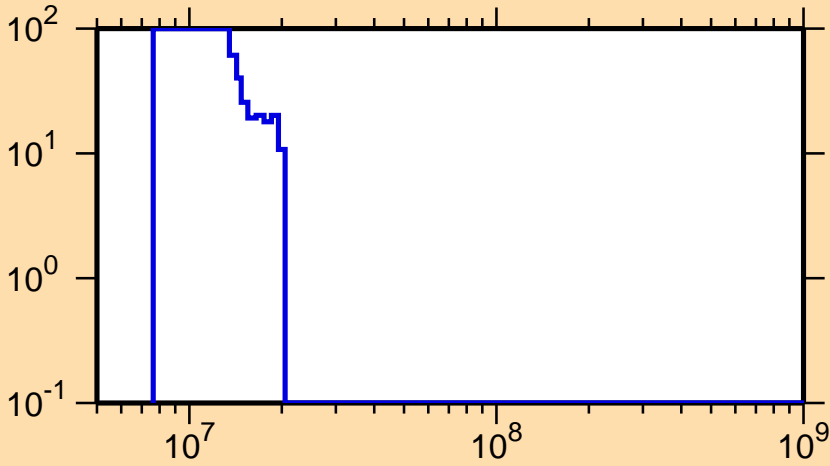



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

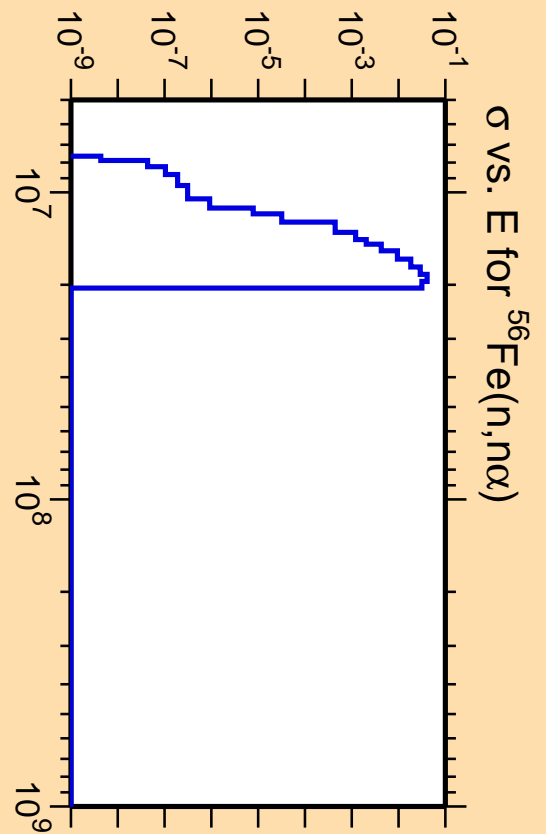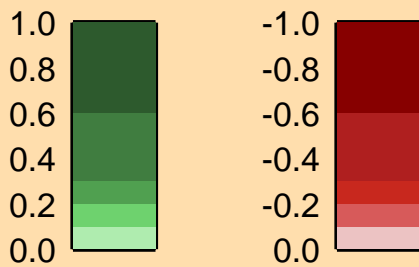

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,np)$

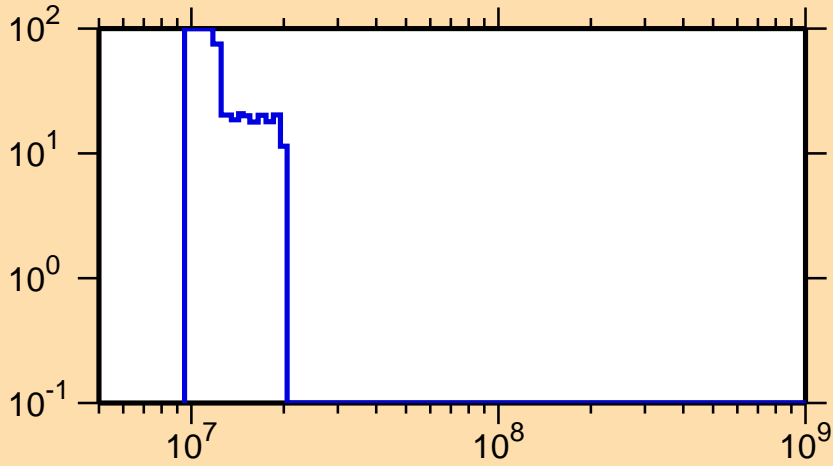



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

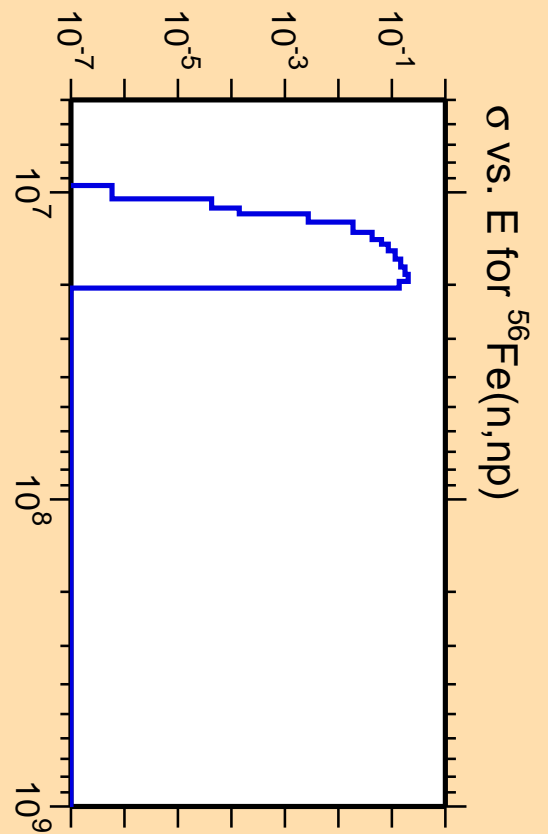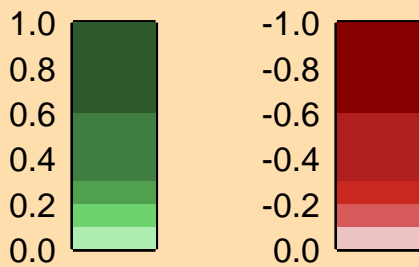


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_1)$


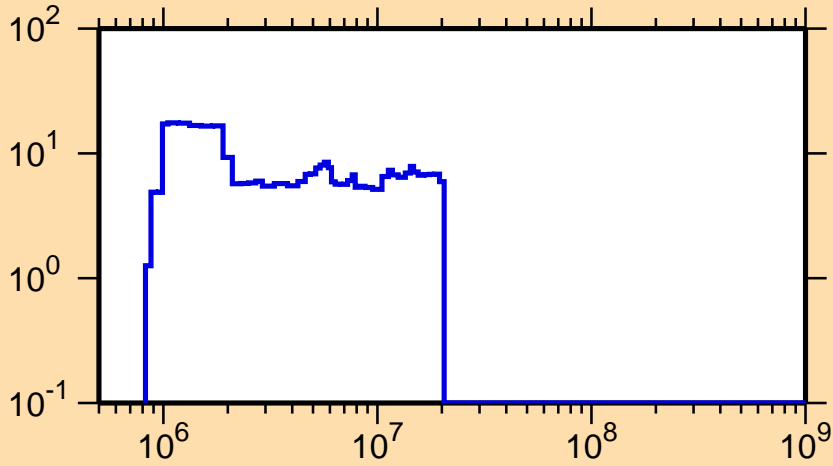


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

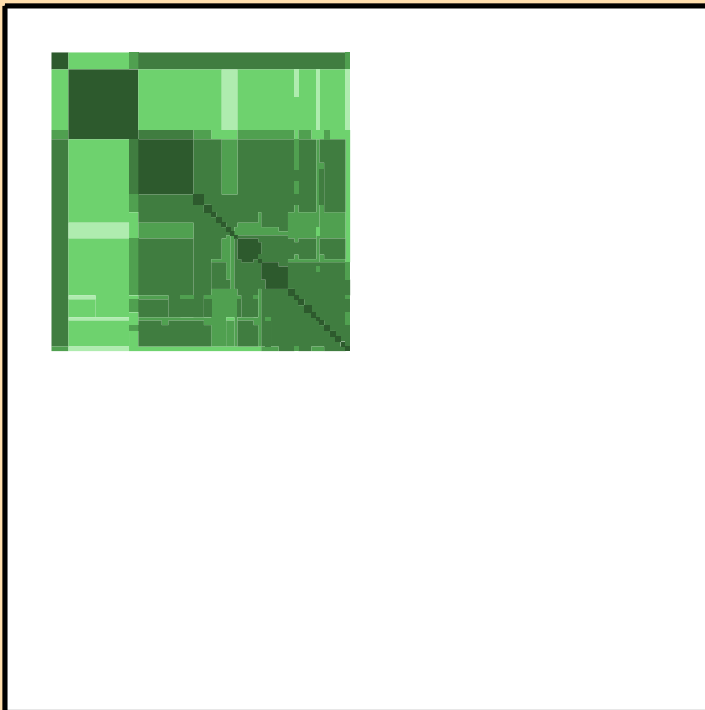

Correlation Matrix

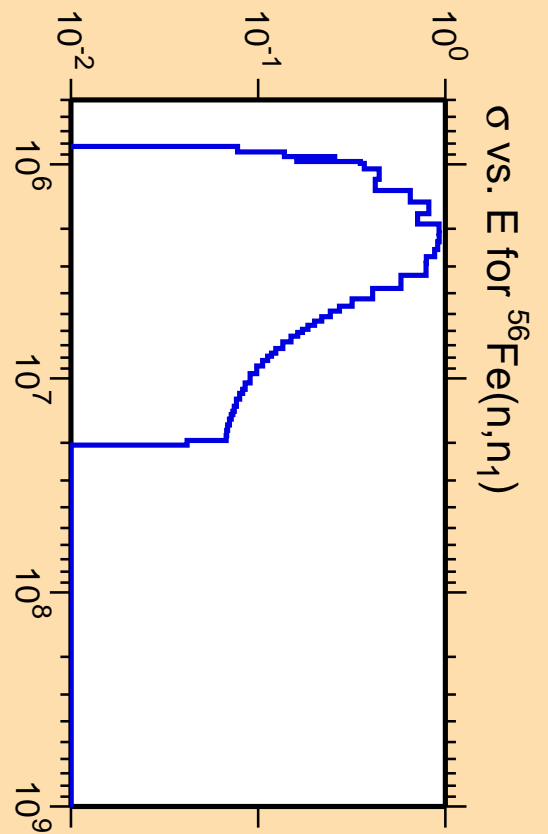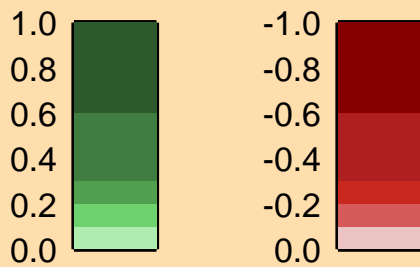


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_2)$

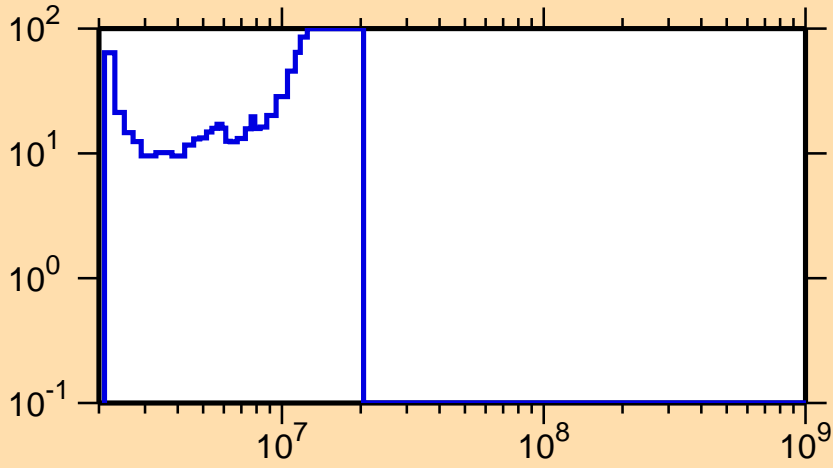



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

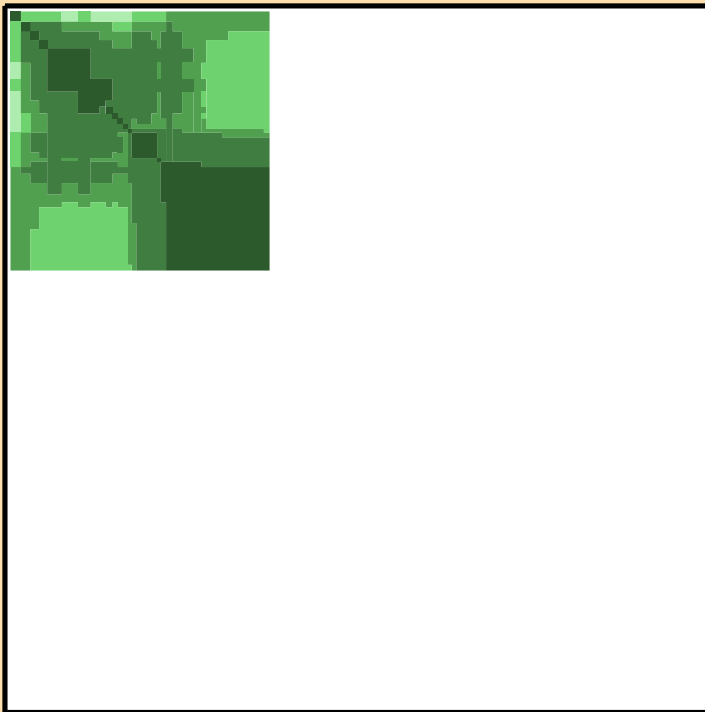

Correlation Matrix

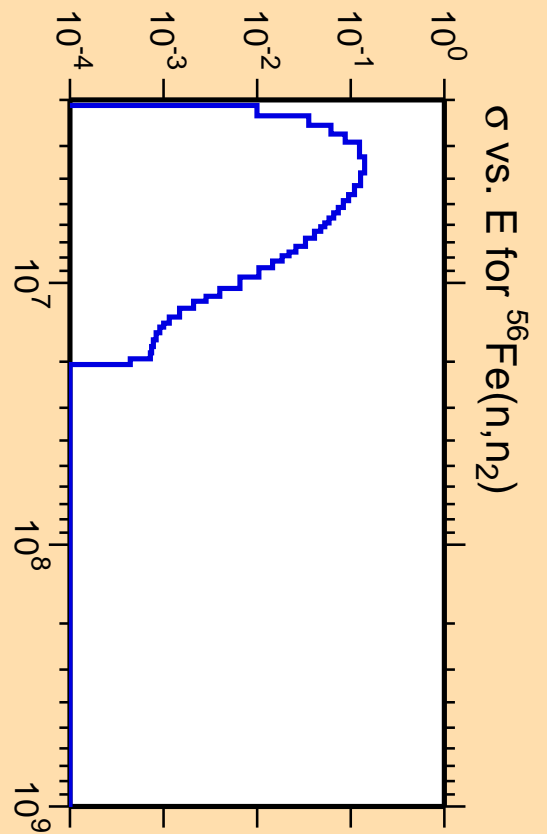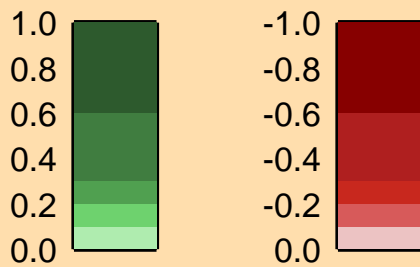

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_3)$


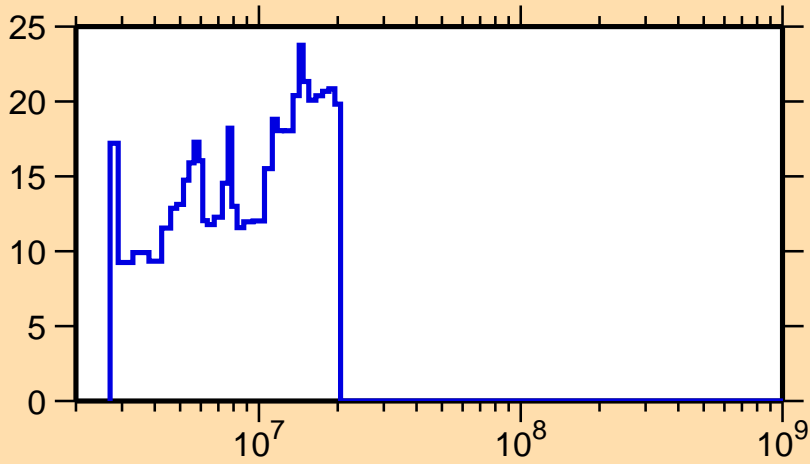


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

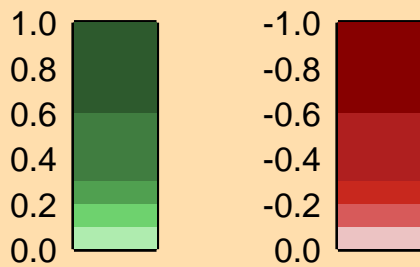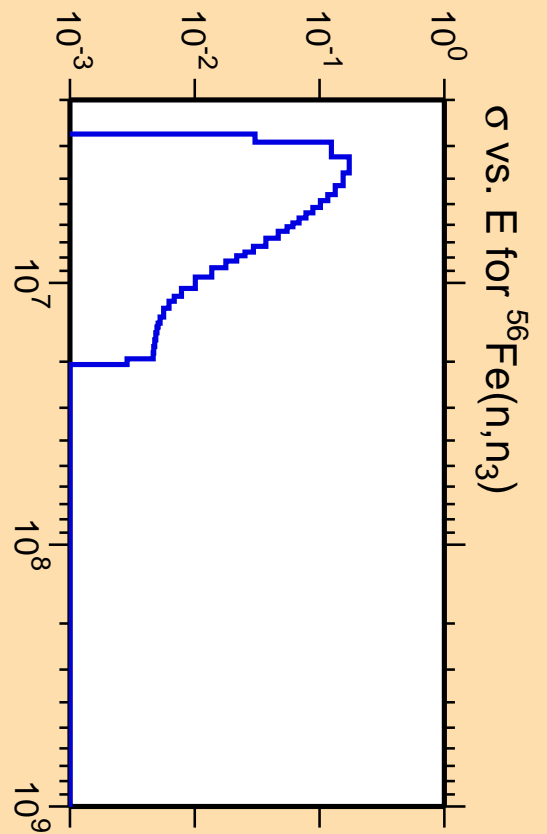


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_4)$

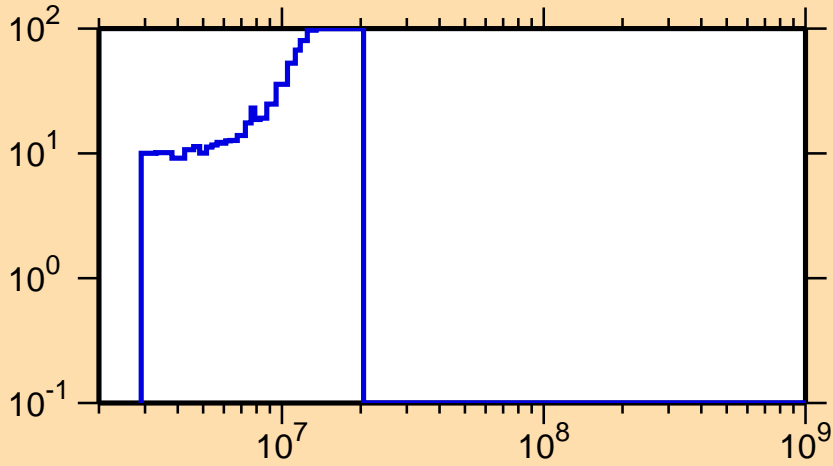



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

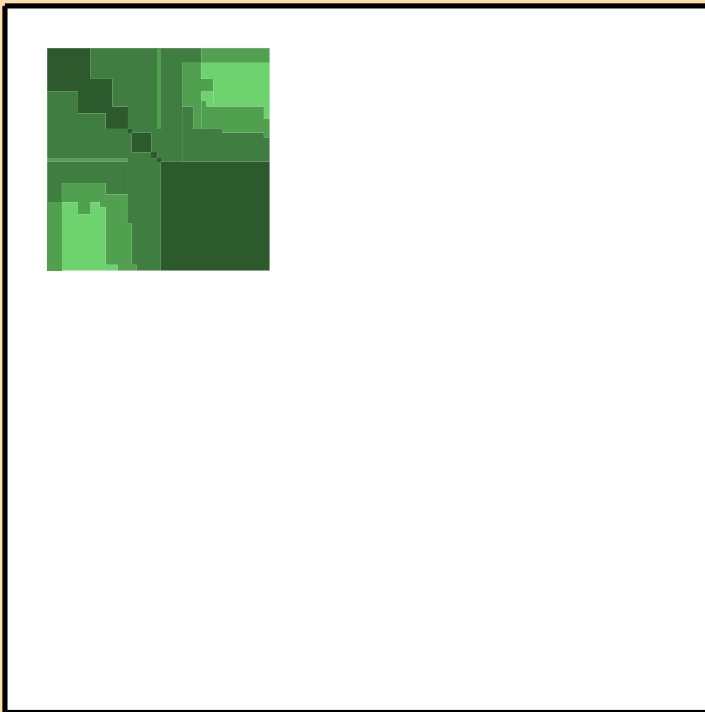

Correlation Matrix

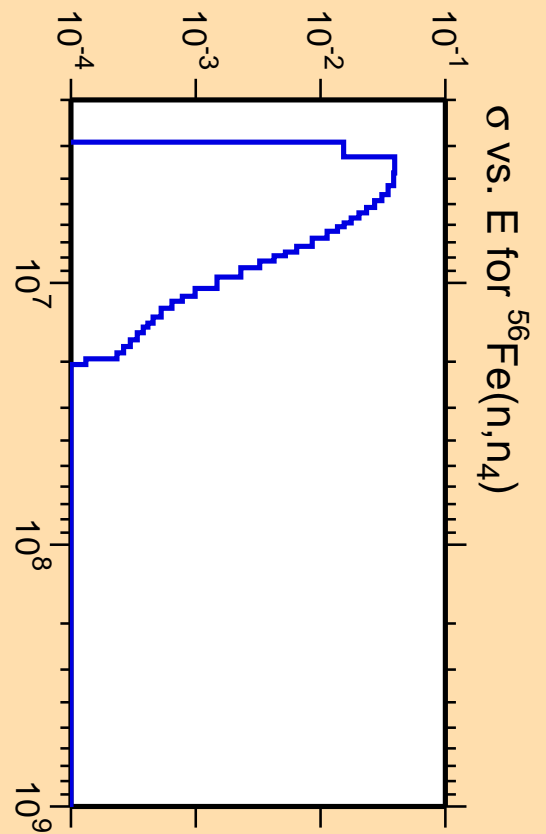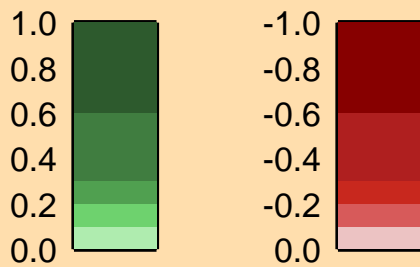


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_5)$

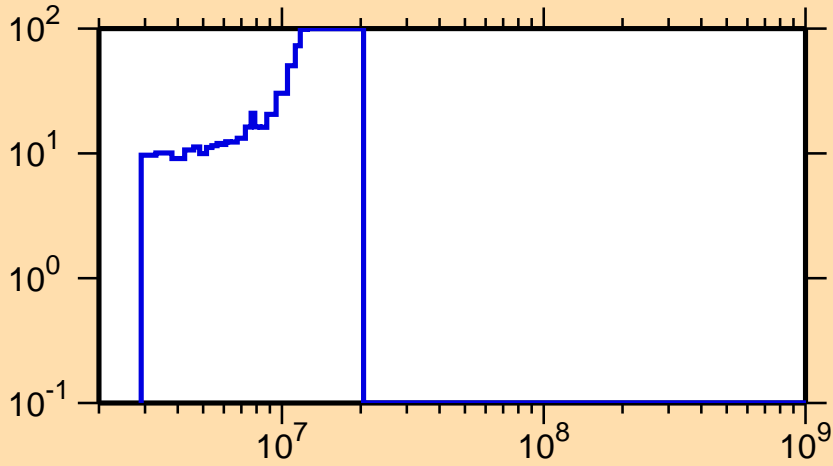



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

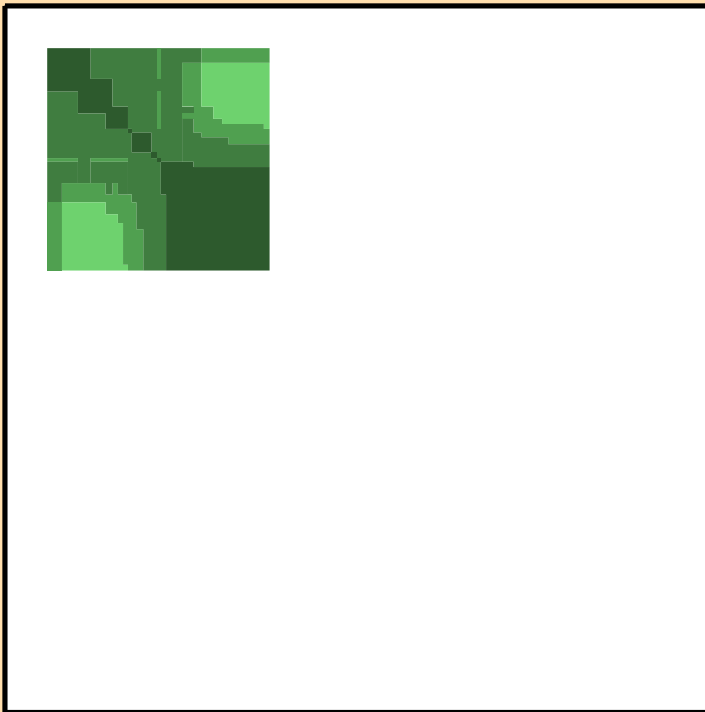

Correlation Matrix

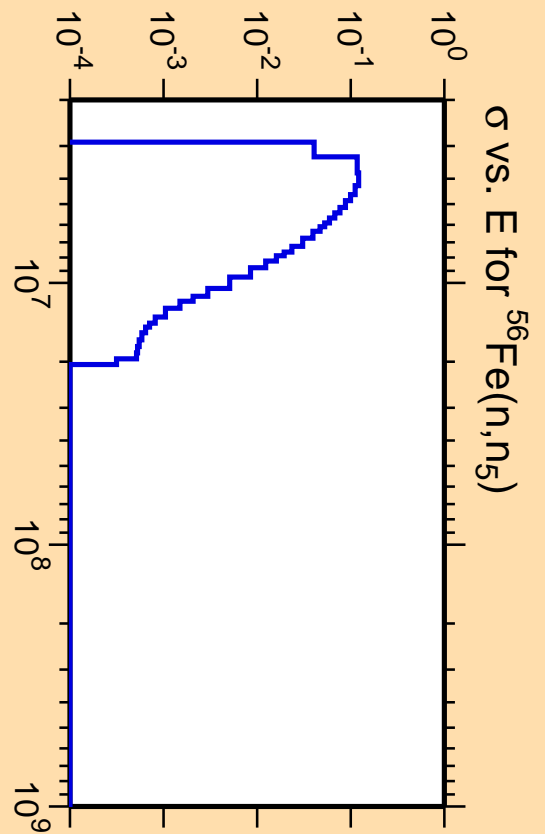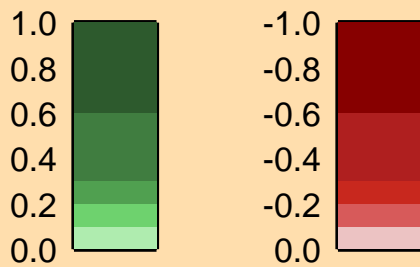


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_6)$

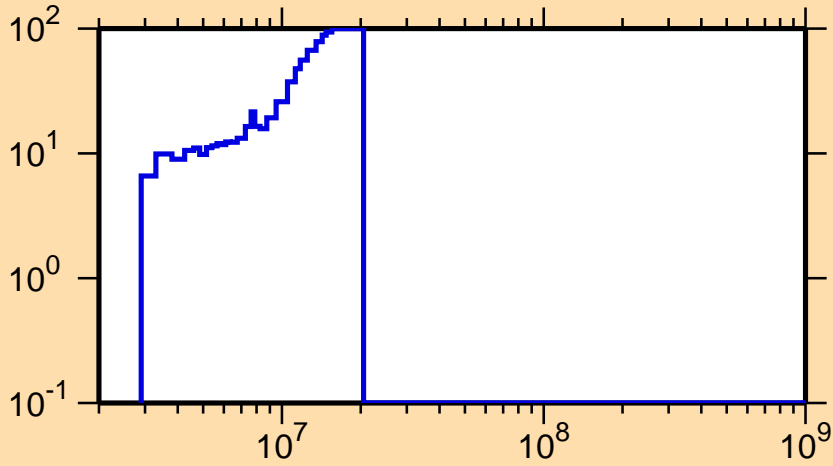



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

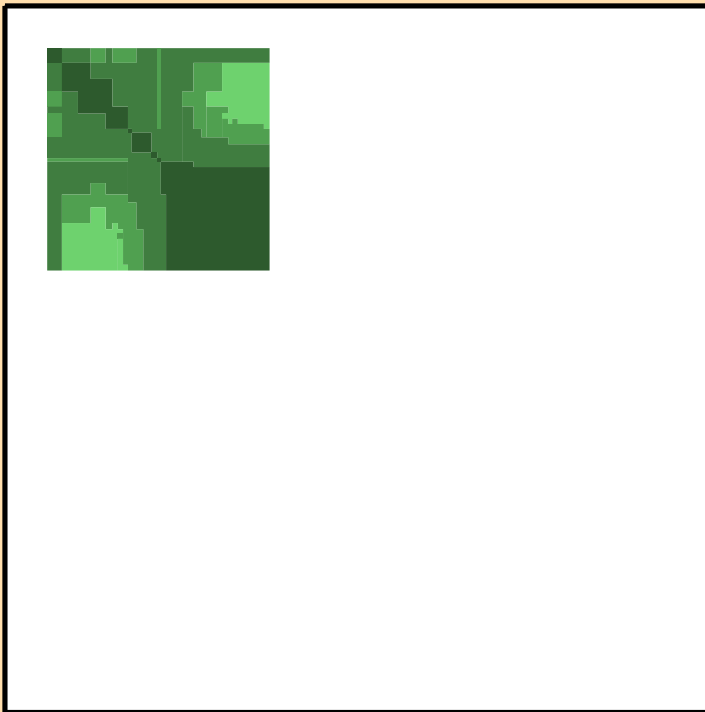

Correlation Matrix

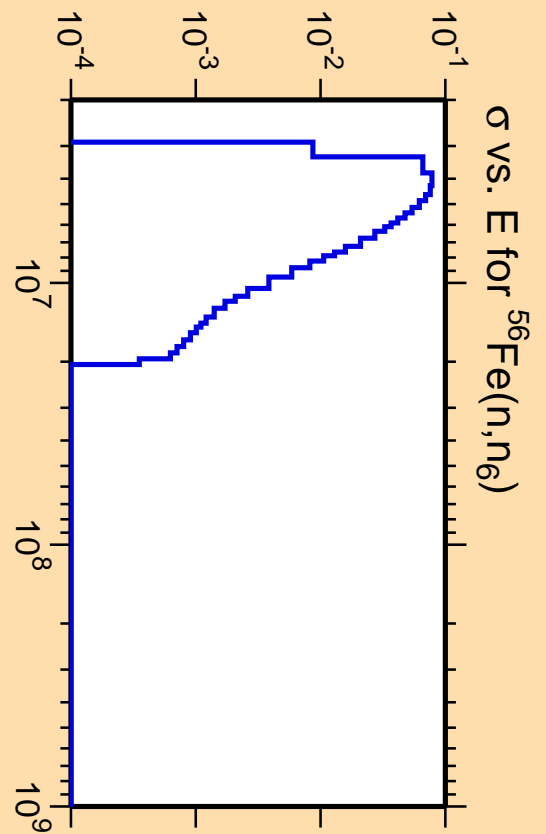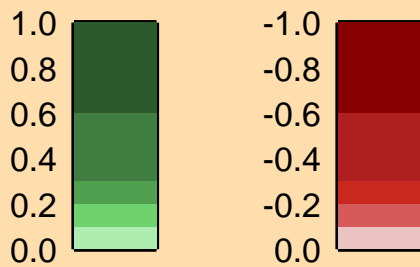

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_7)$


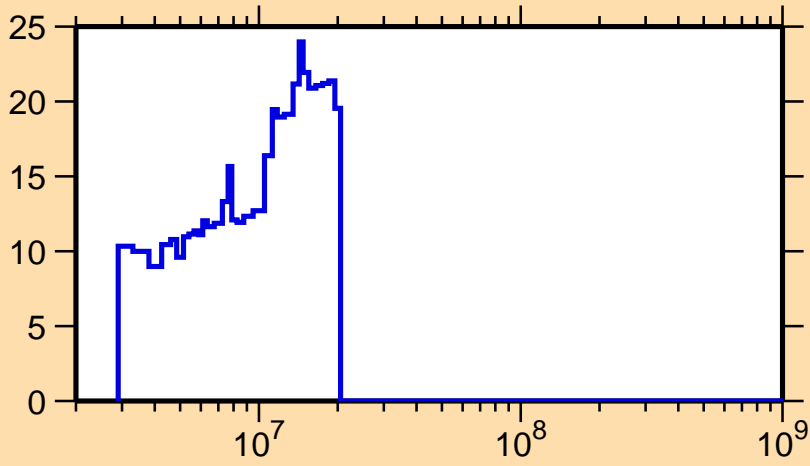


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

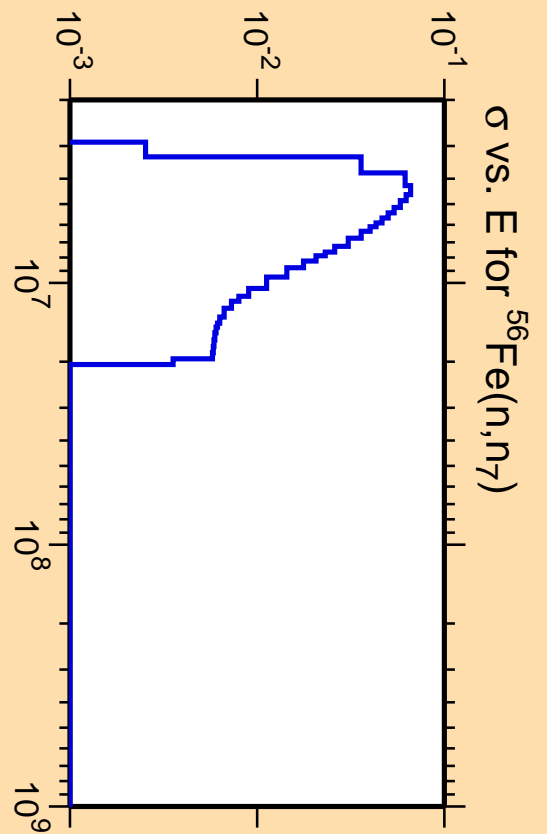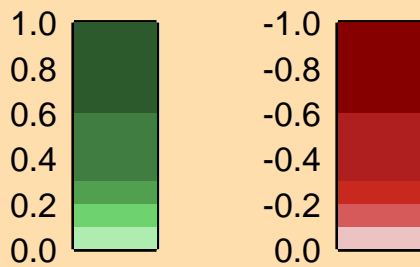


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_8)$


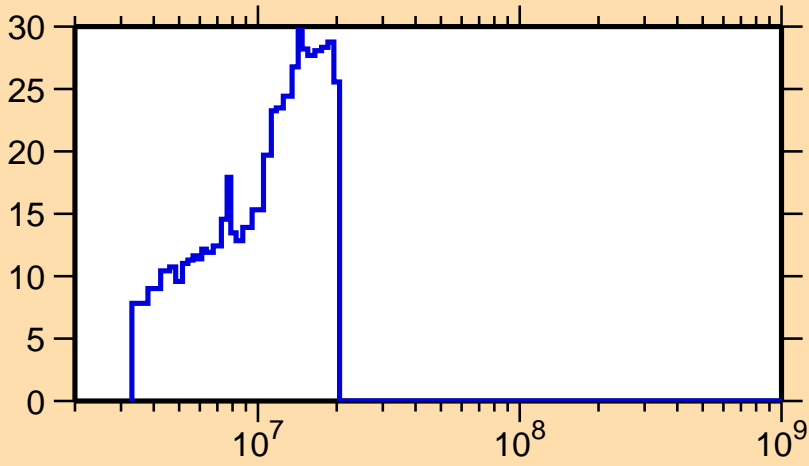


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

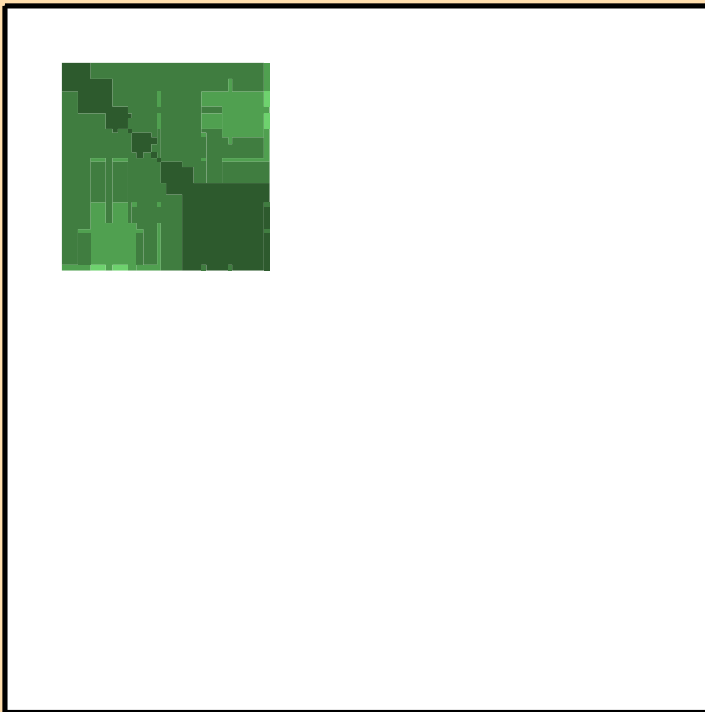

Correlation Matrix

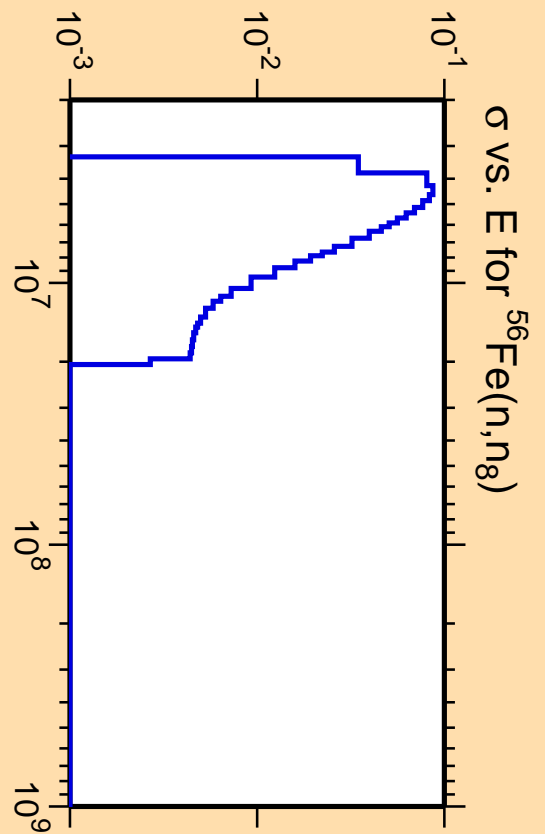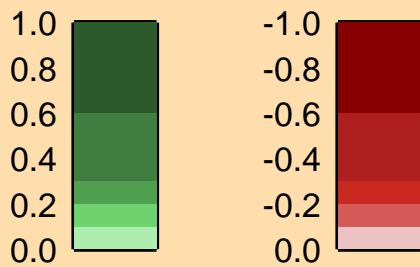

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_g)$


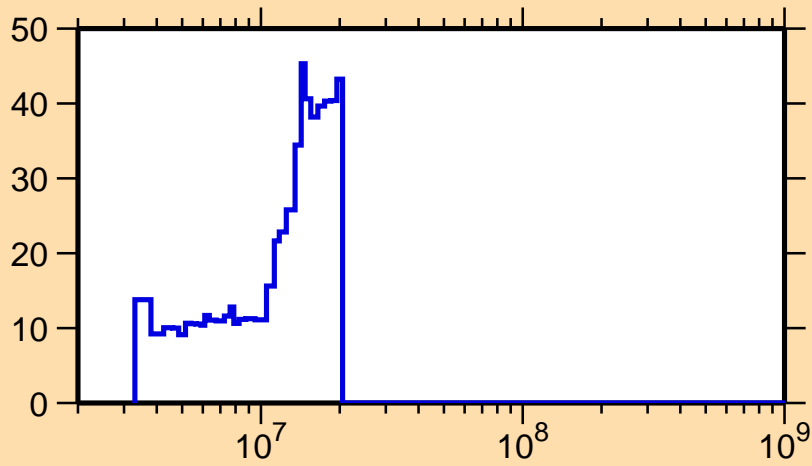


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

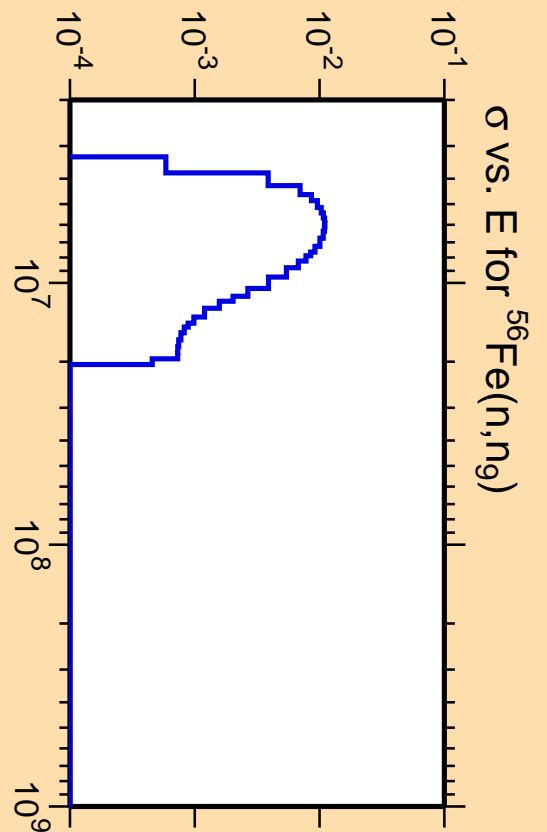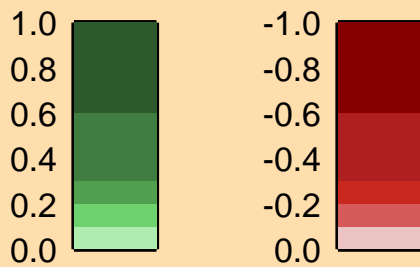

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{10})$


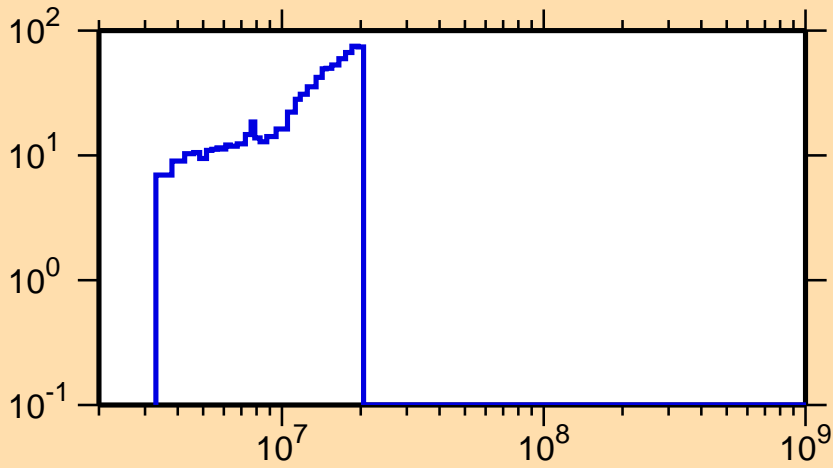


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

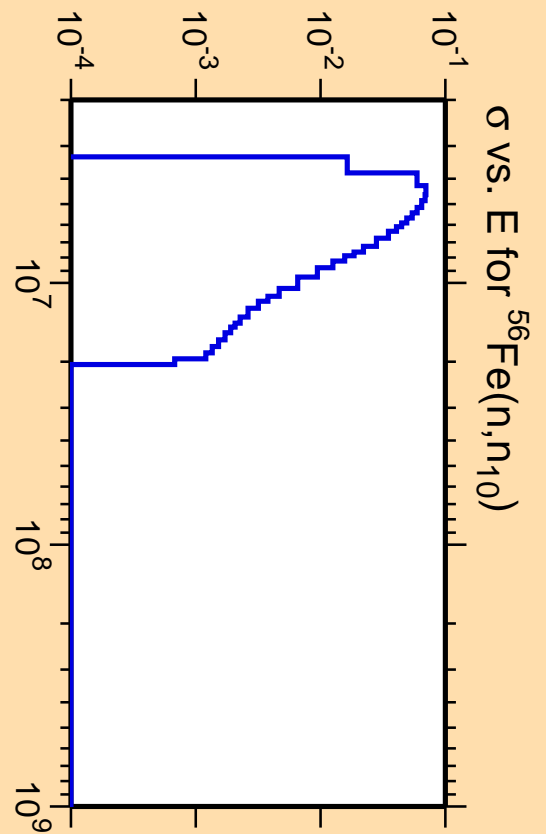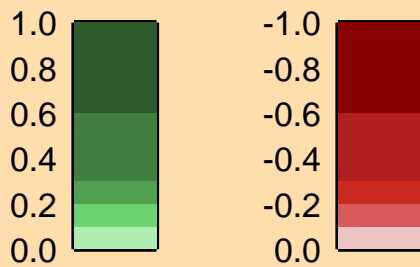


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{11})$

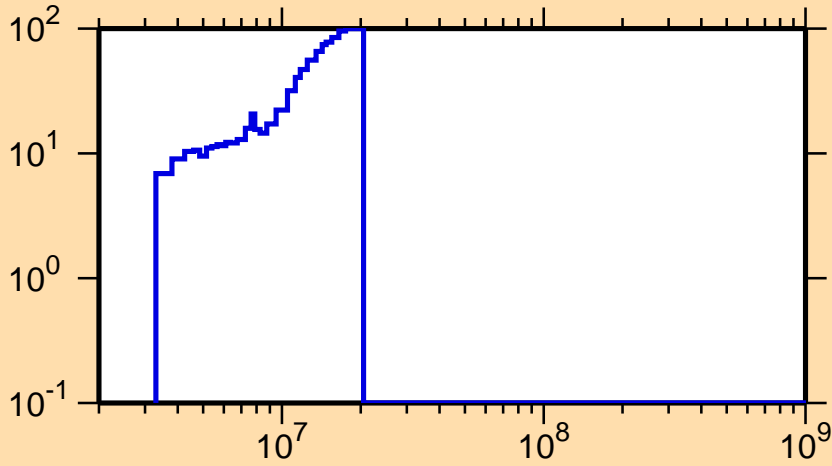



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

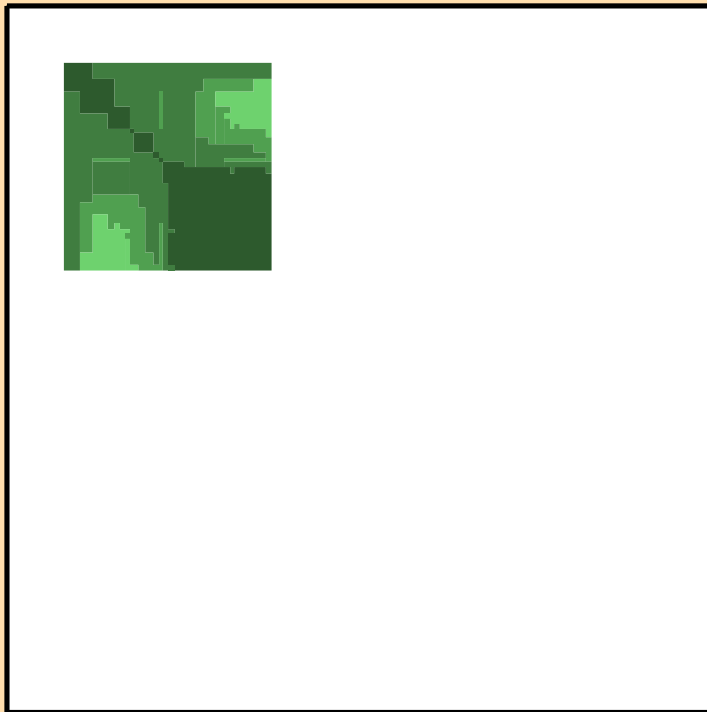

Correlation Matrix

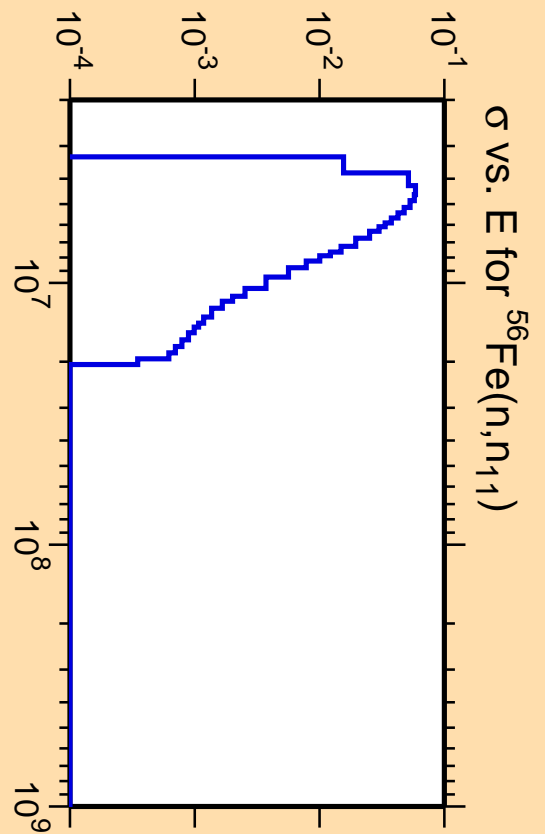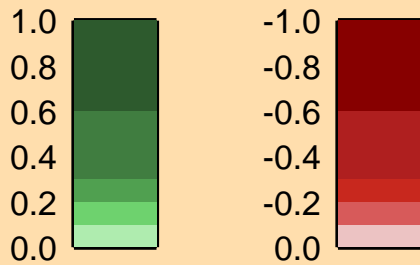


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{12})$


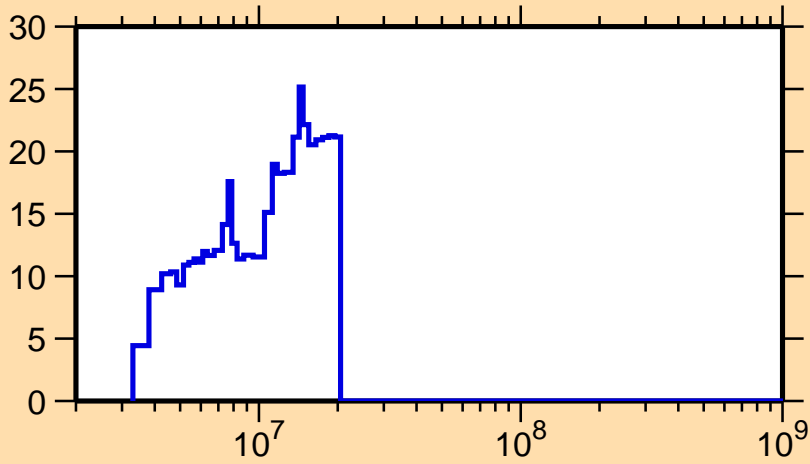


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

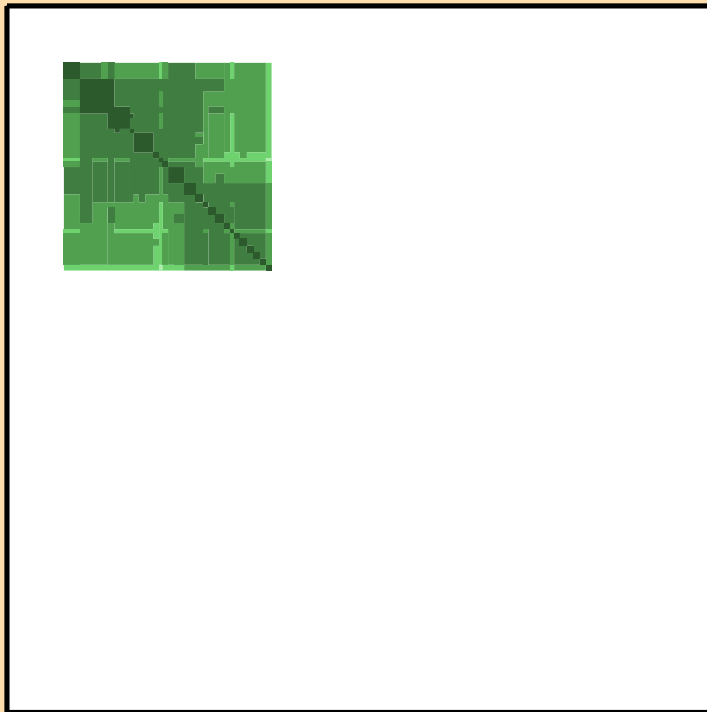

Correlation Matrix

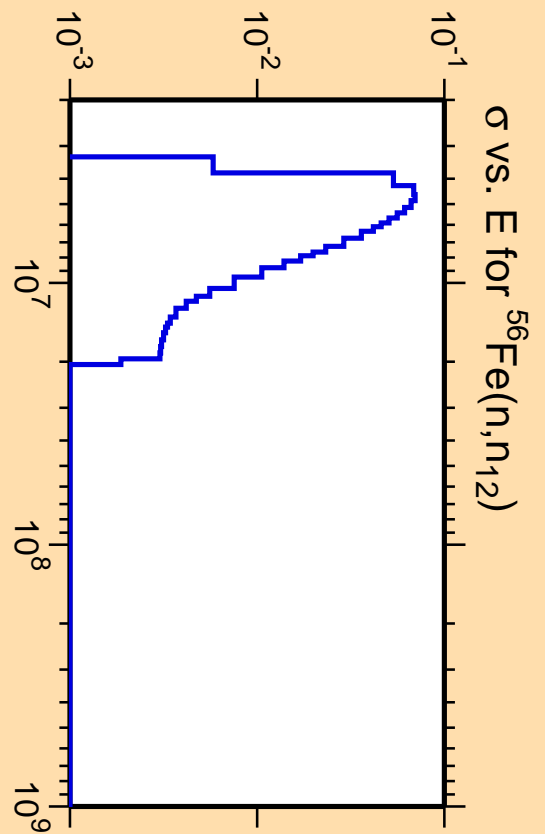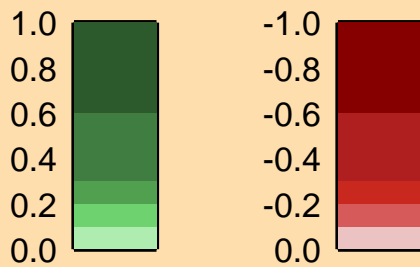

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{13})$

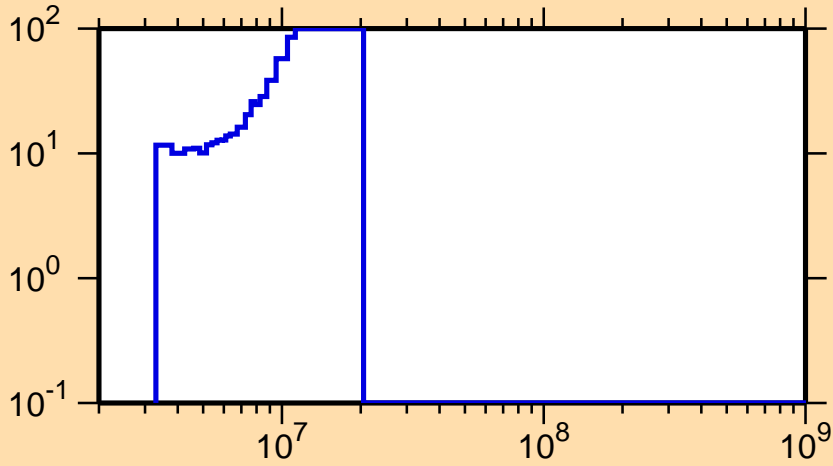



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

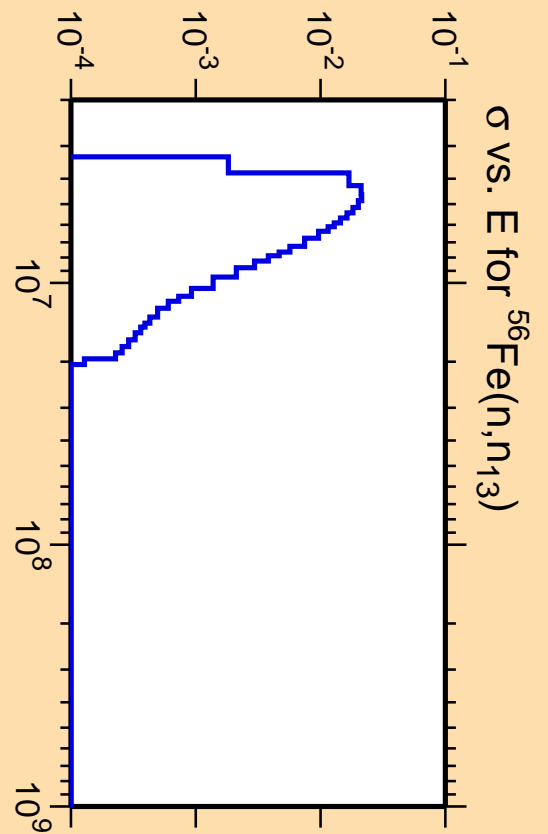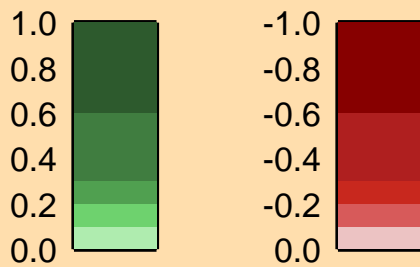


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{14})$

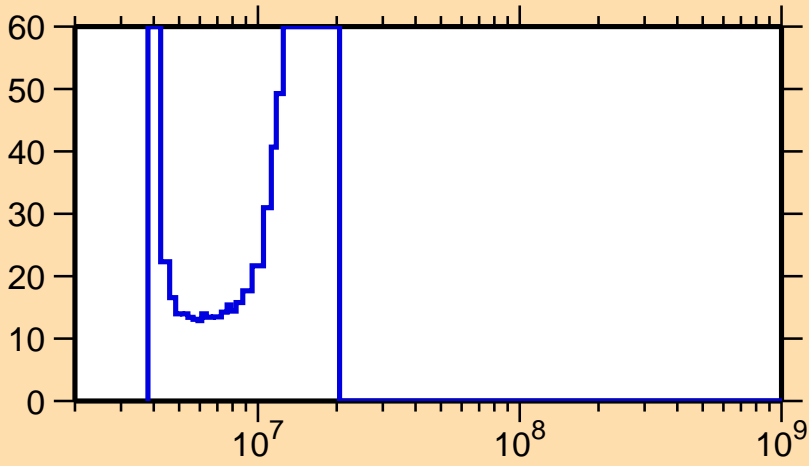



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

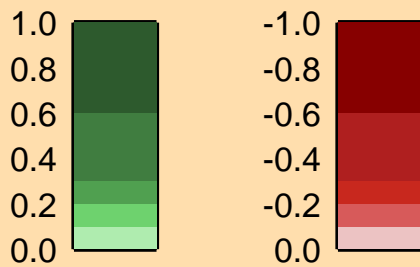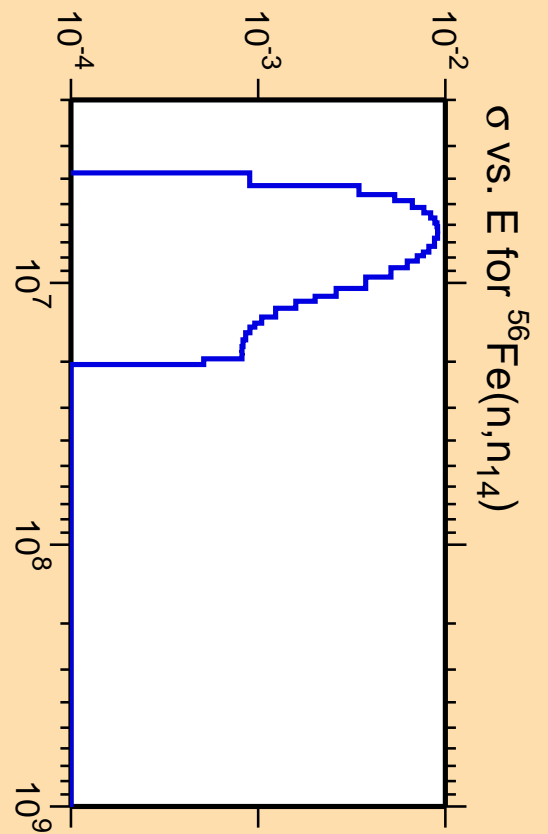


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{15})$

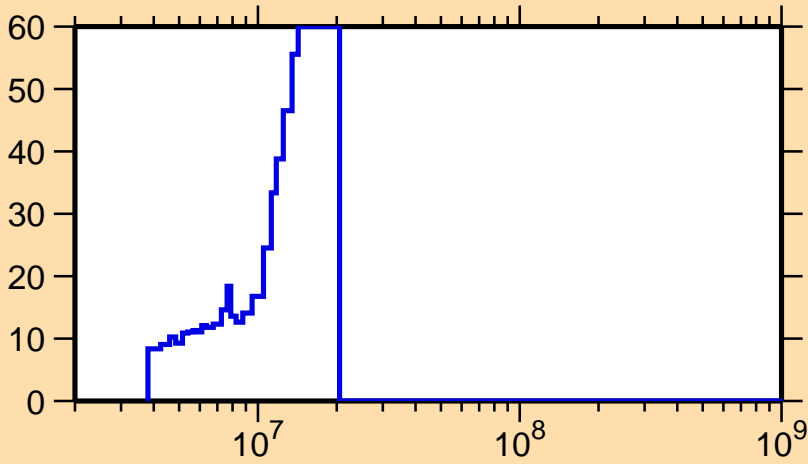



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

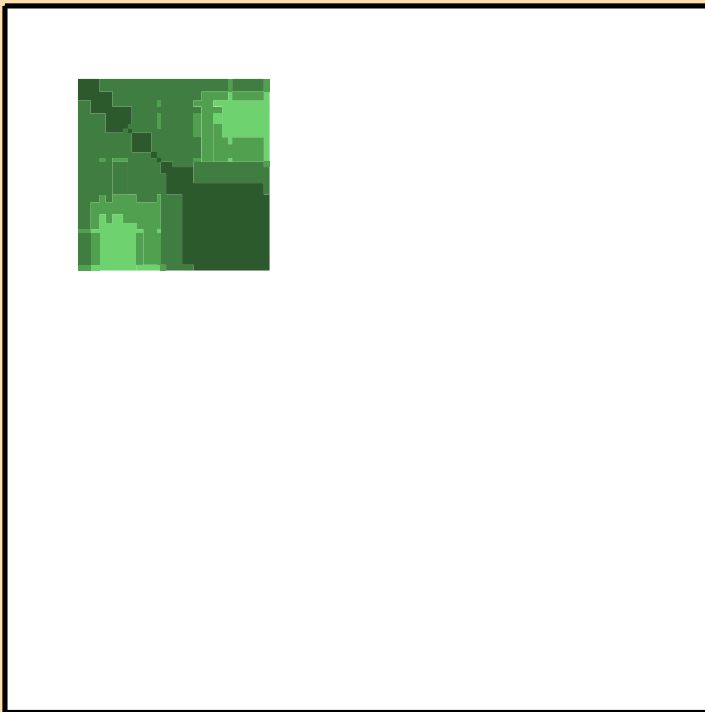

Correlation Matrix

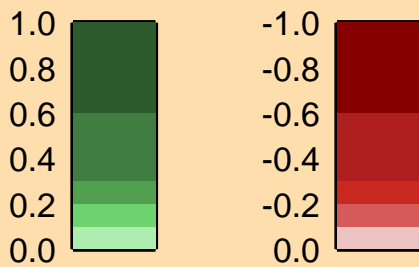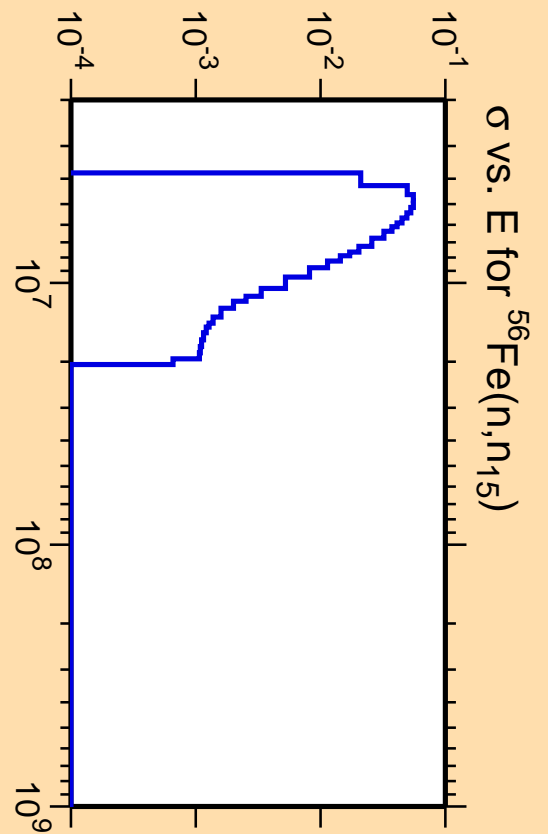


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{16})$


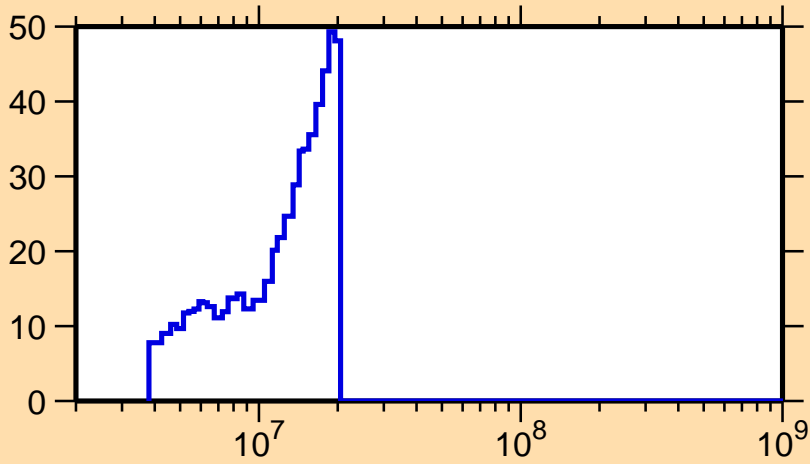


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

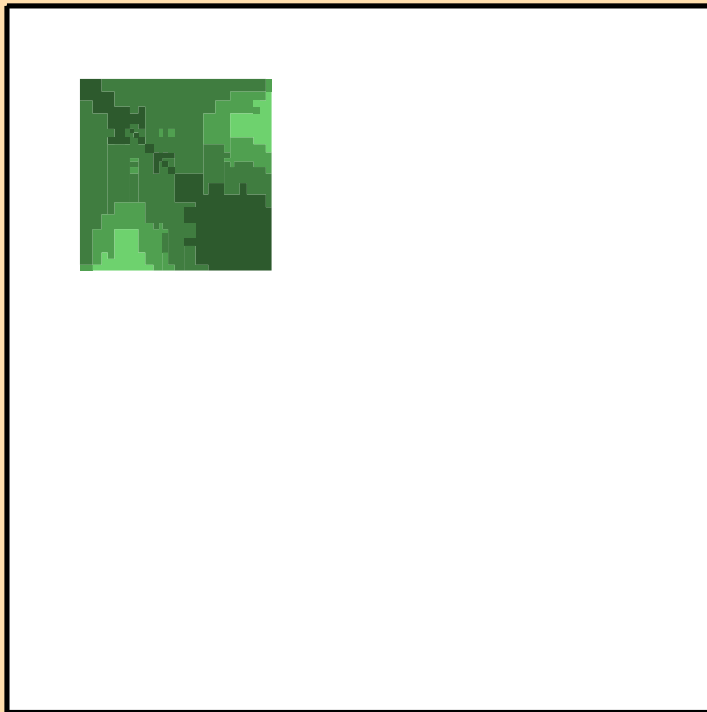

Correlation Matrix

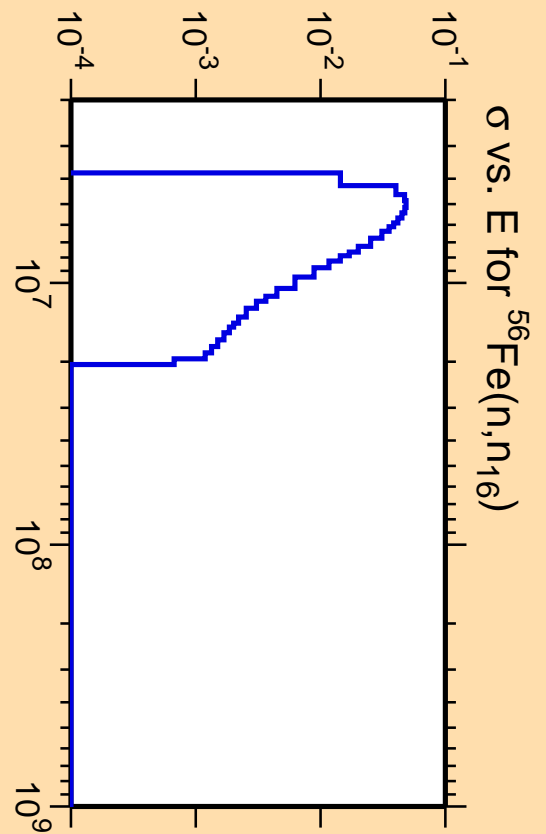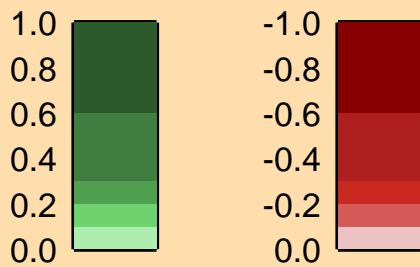


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{17})$


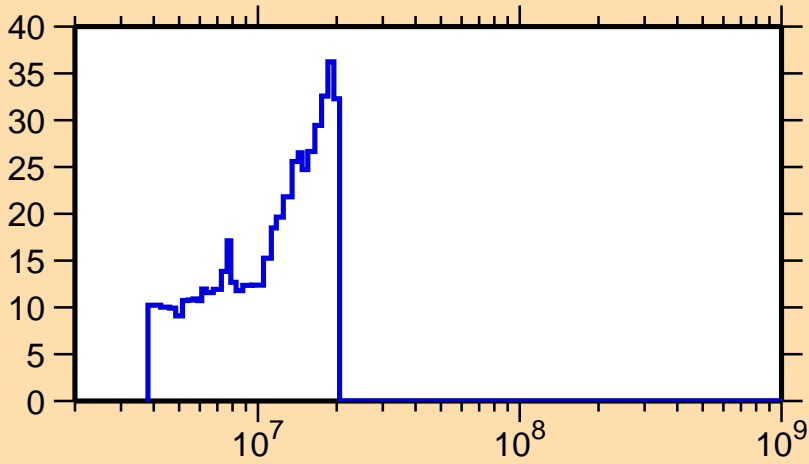


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

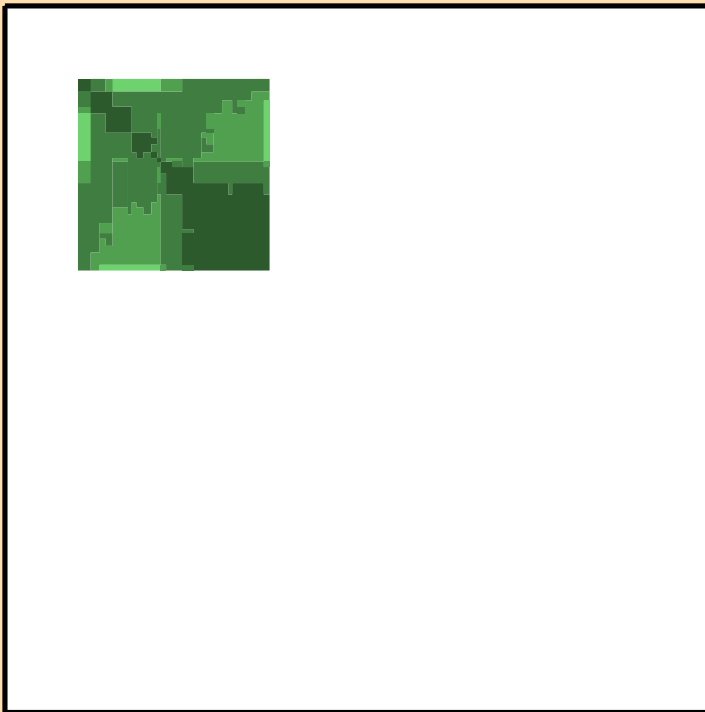

Correlation Matrix

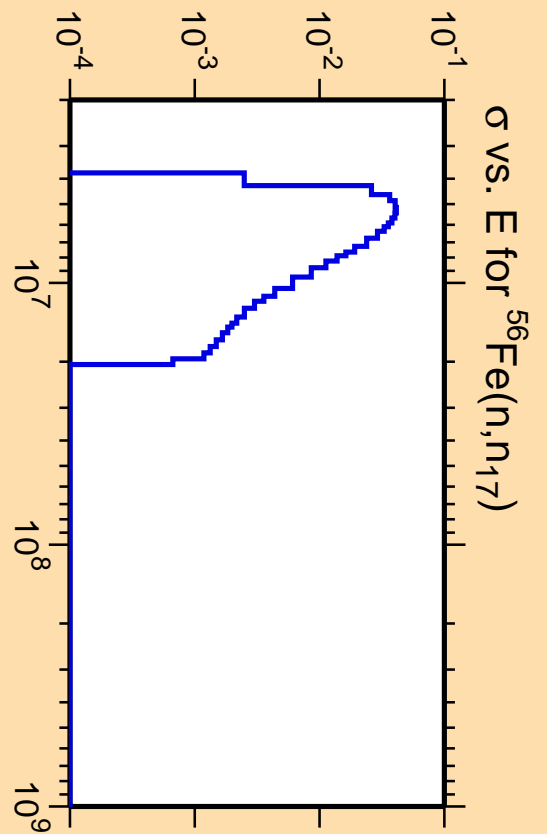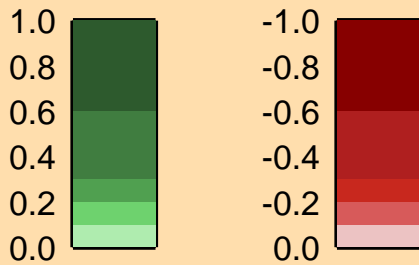


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{18})$


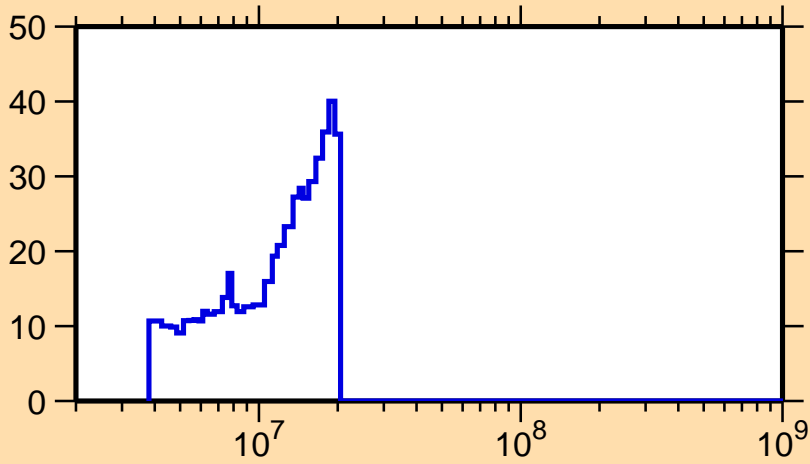


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

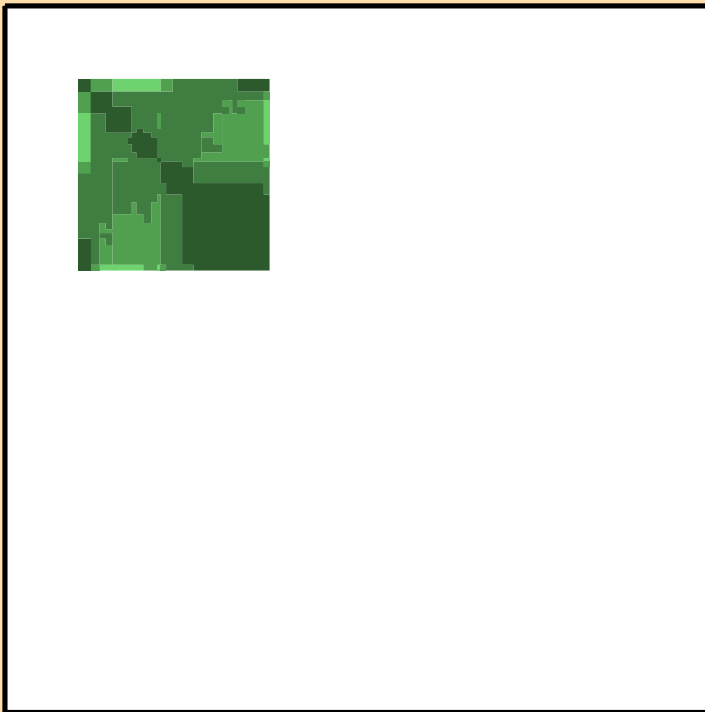

Correlation Matrix

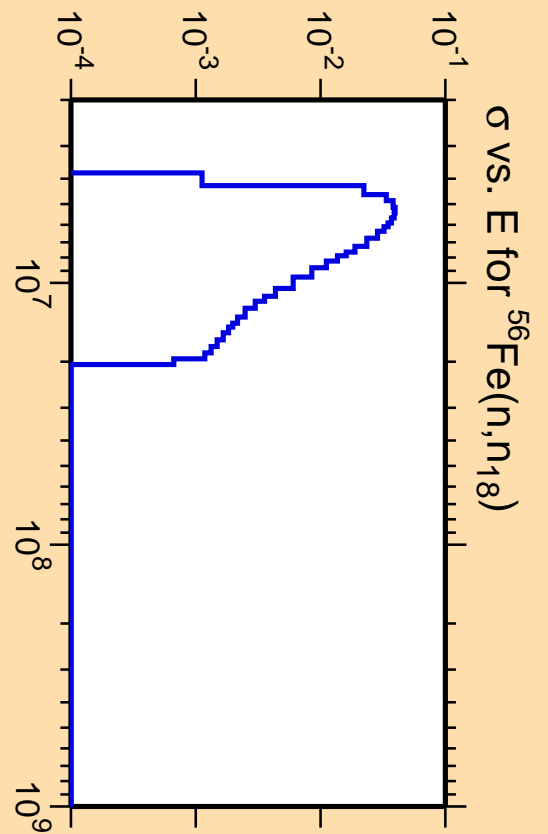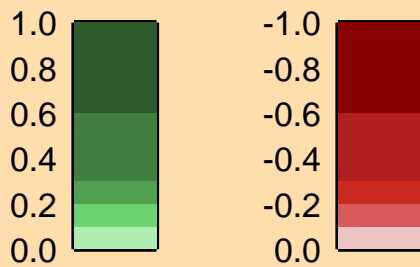


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{19})$


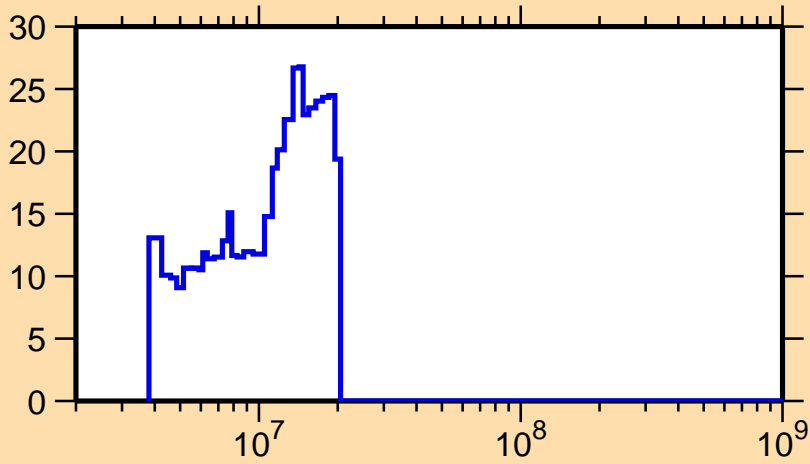


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

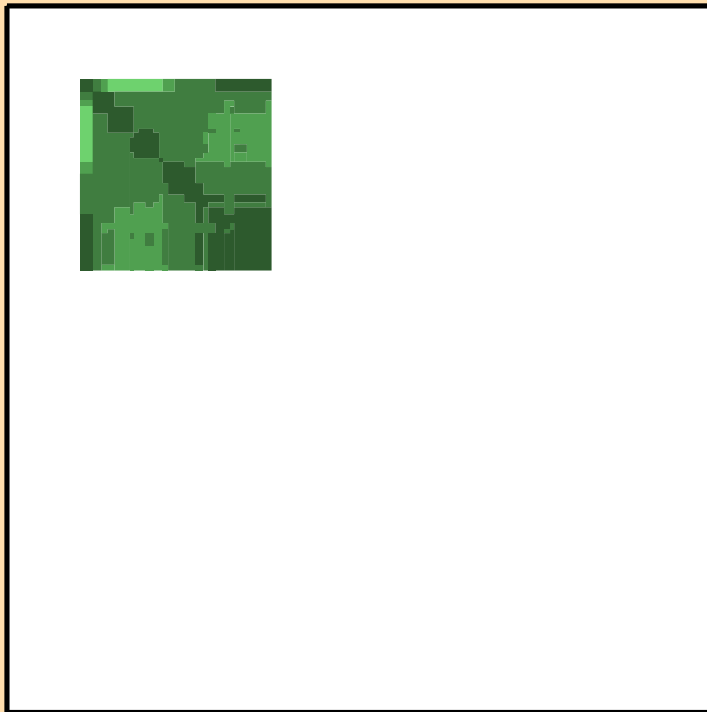

Correlation Matrix

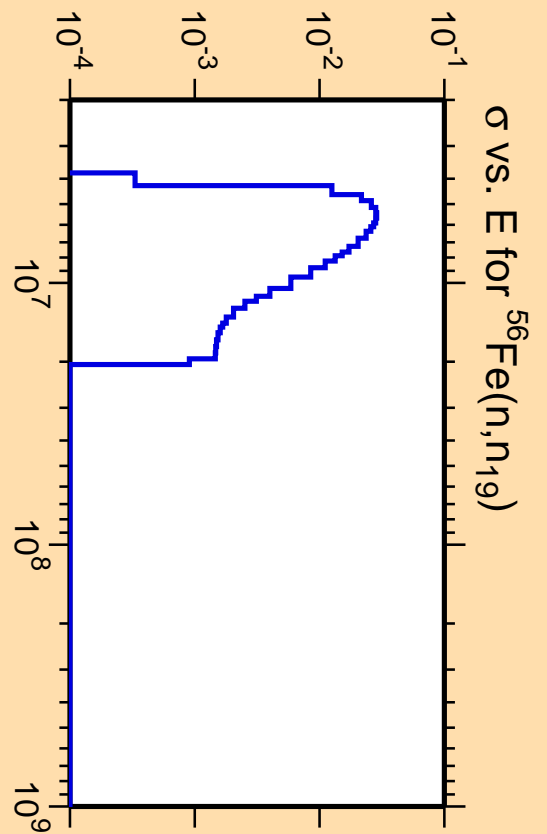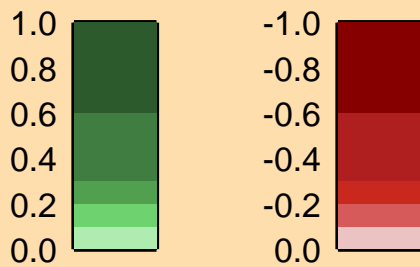

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{20})$


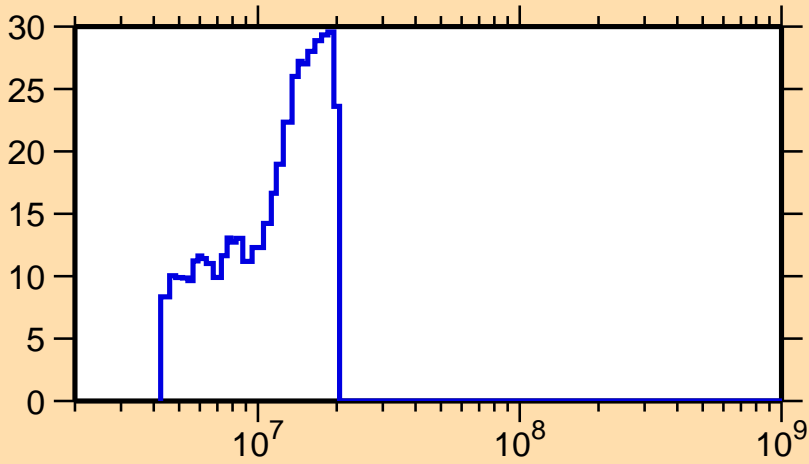


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

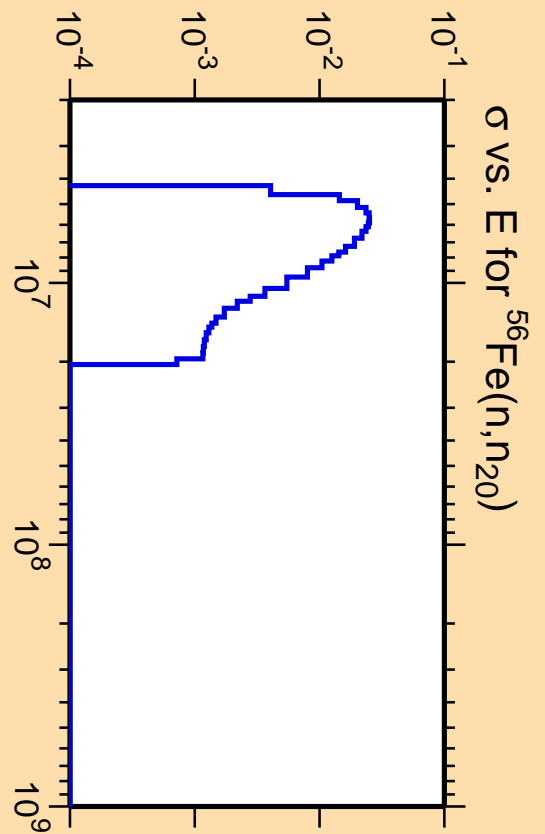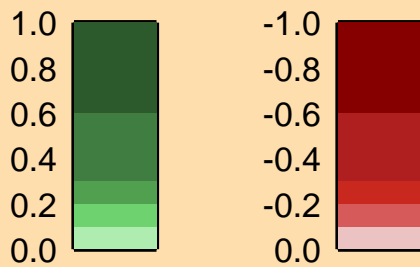


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{21})$

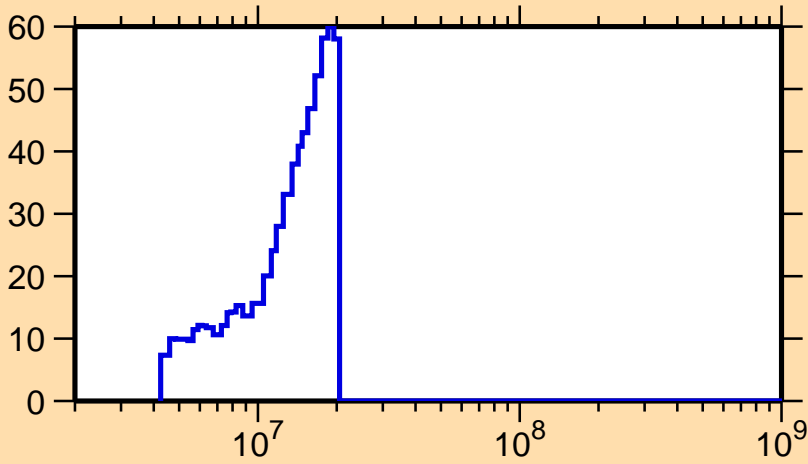



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

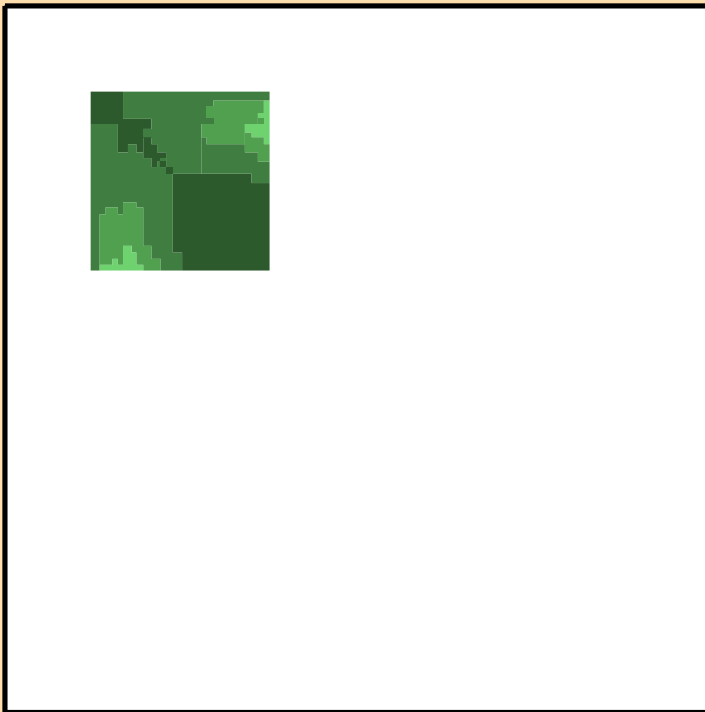

Correlation Matrix

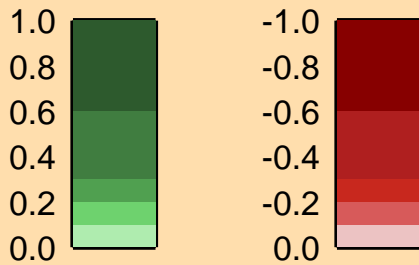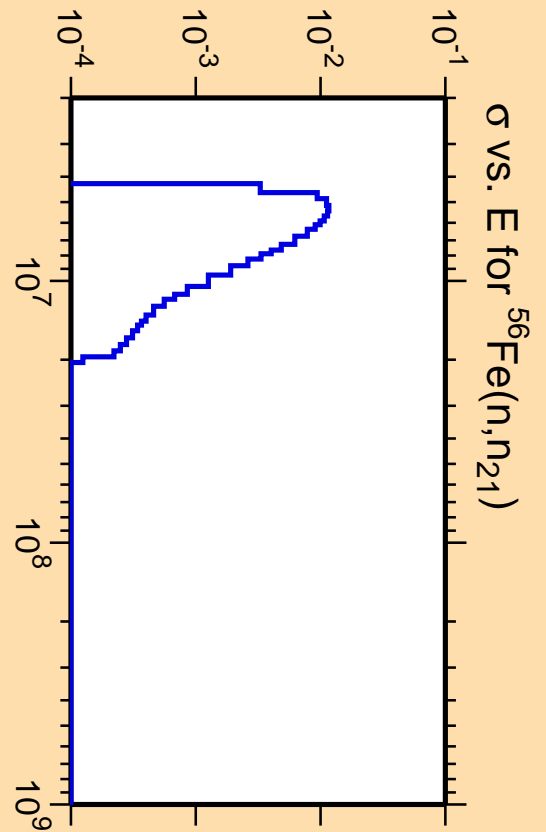

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{22})$


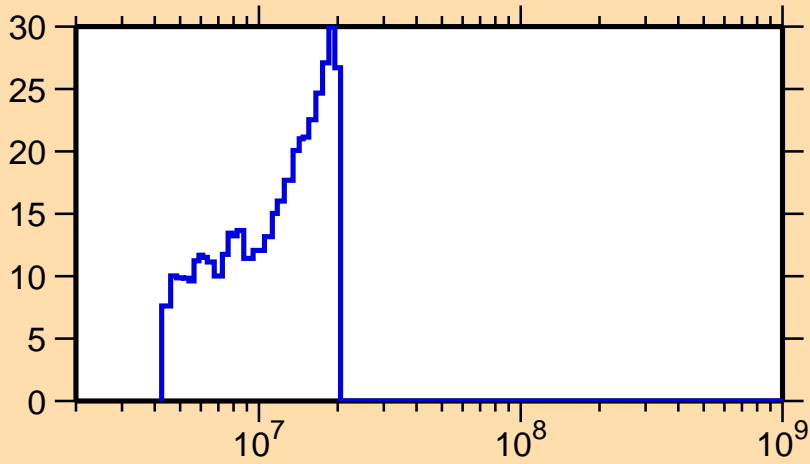


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

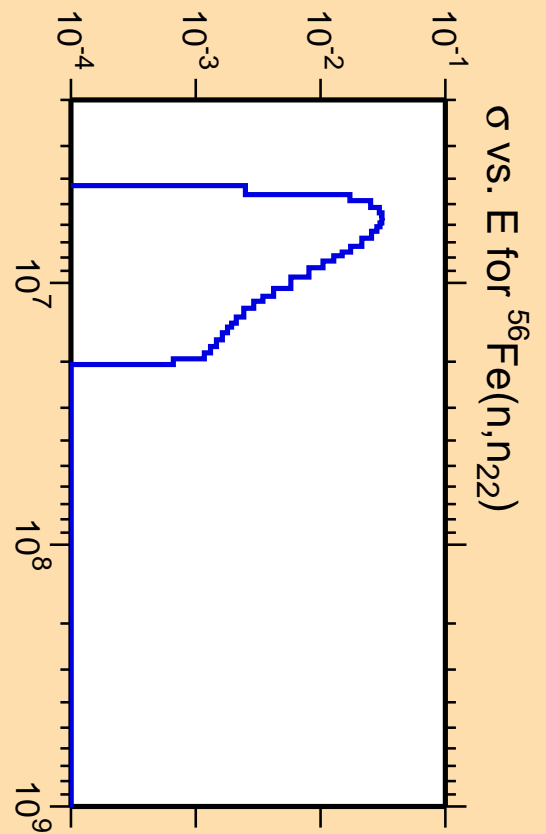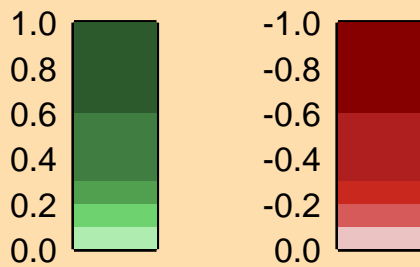


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{23})$


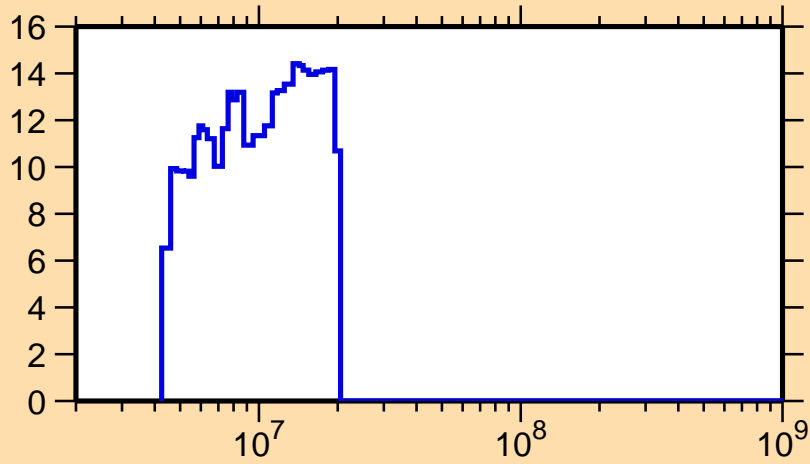


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

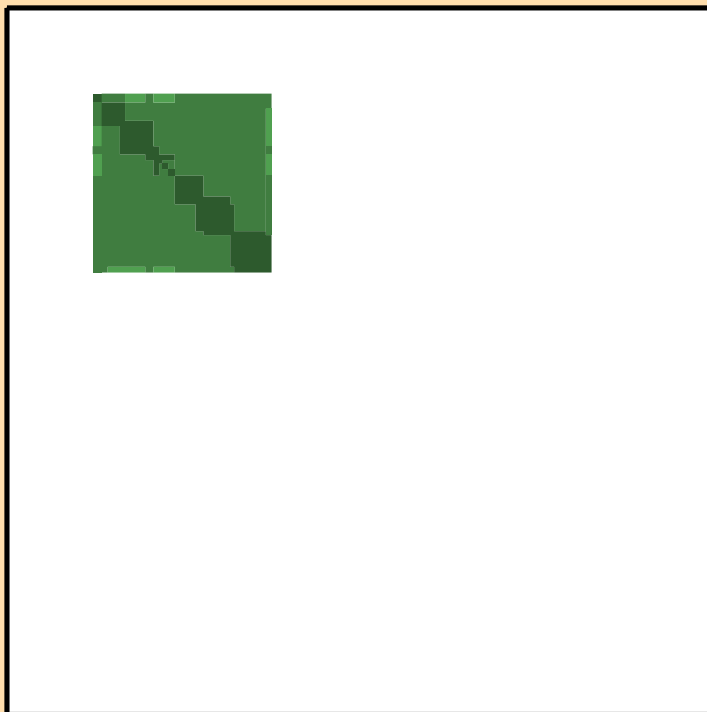

Correlation Matrix

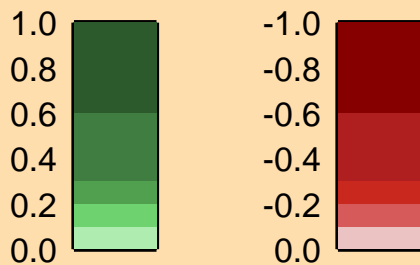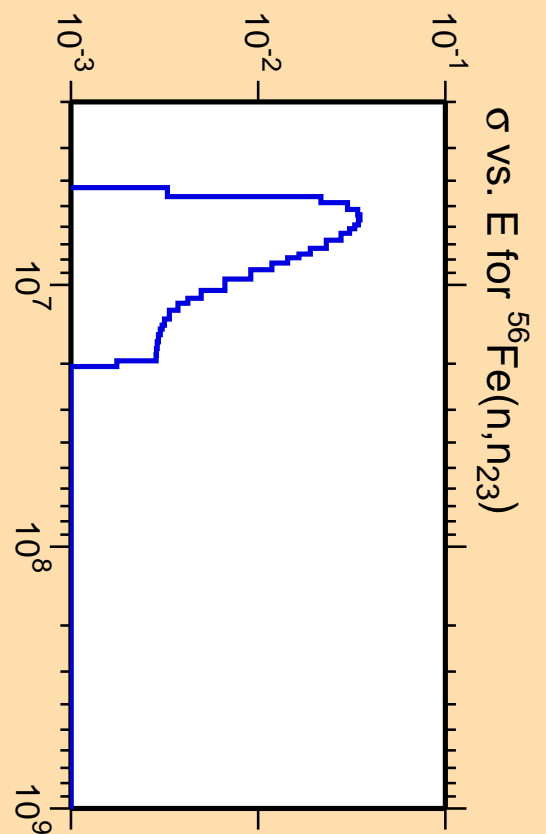

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{24})$


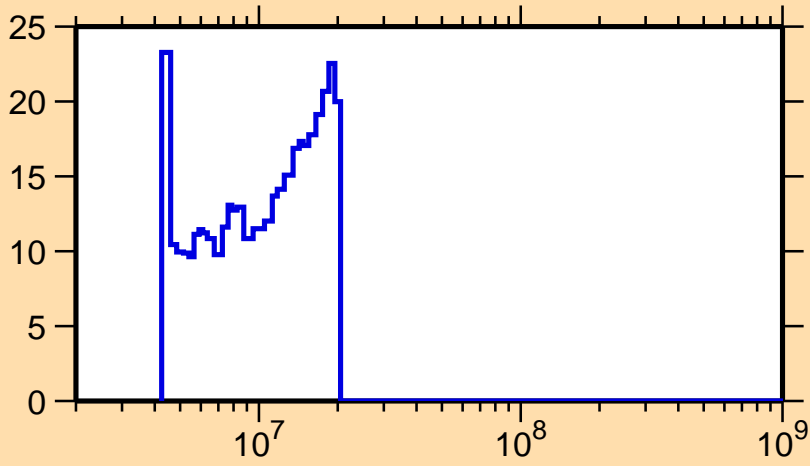


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

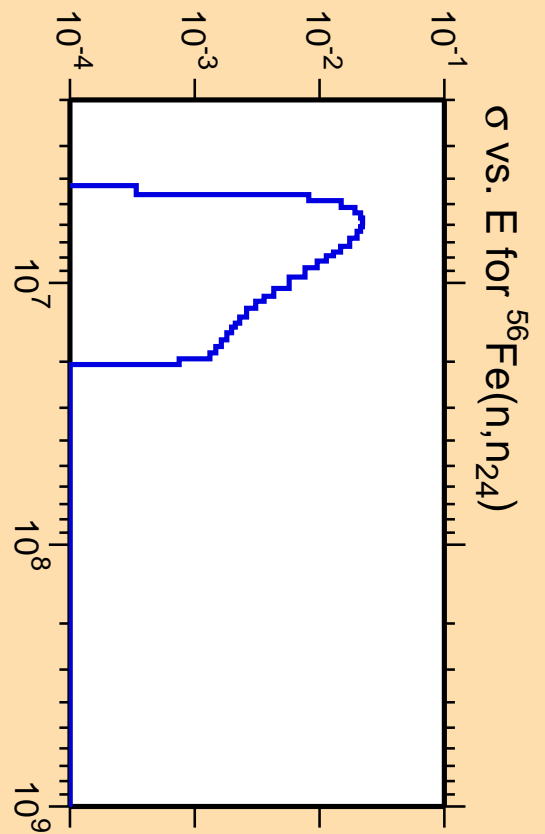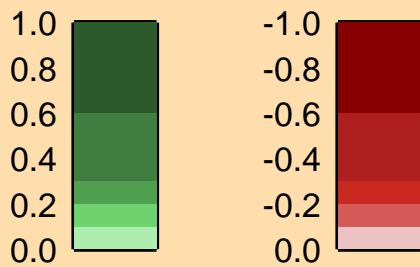

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n_{25})$


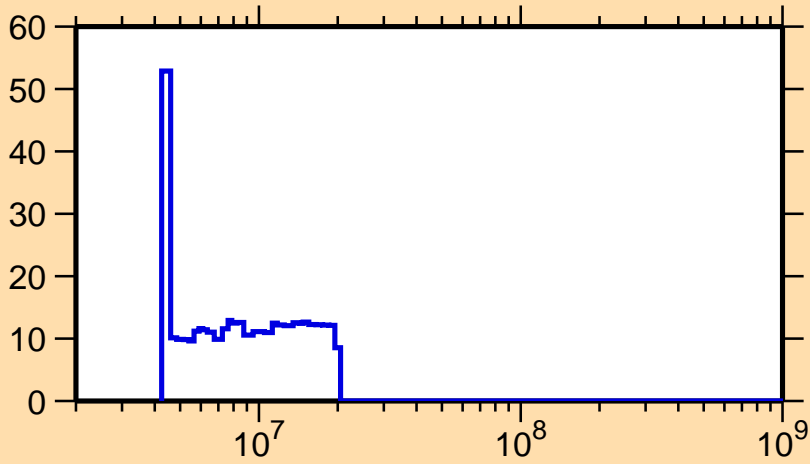


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

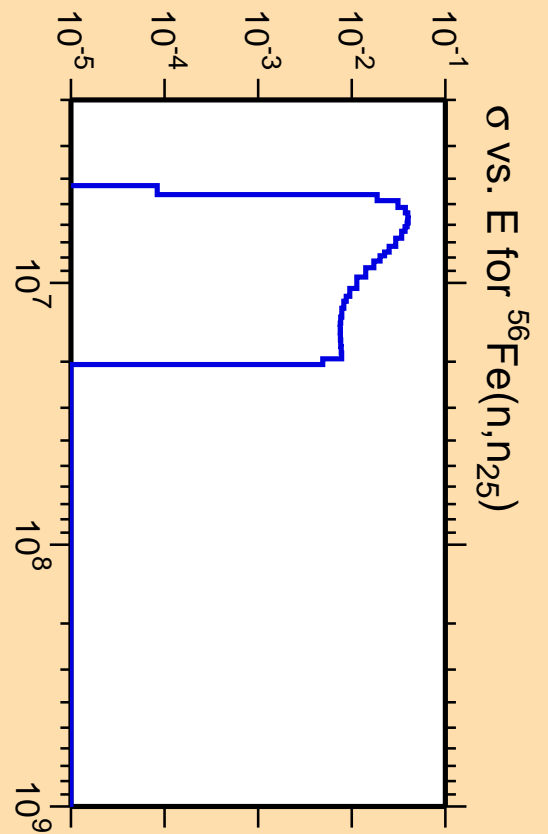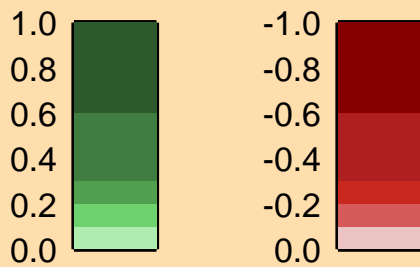


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,n\text{cont.})$

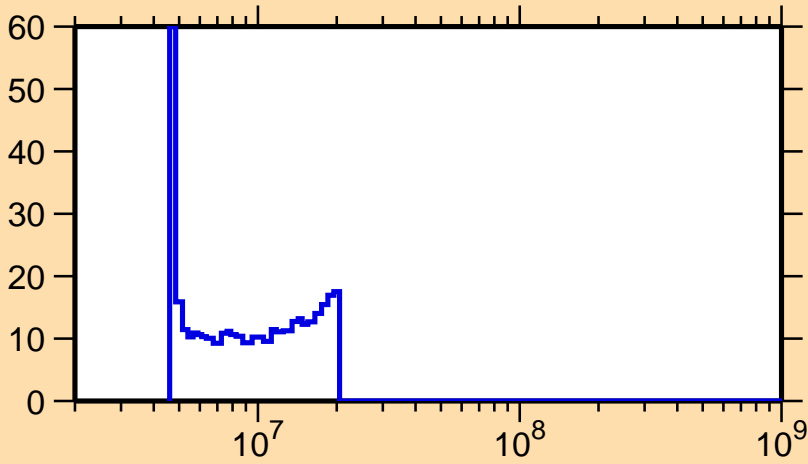



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

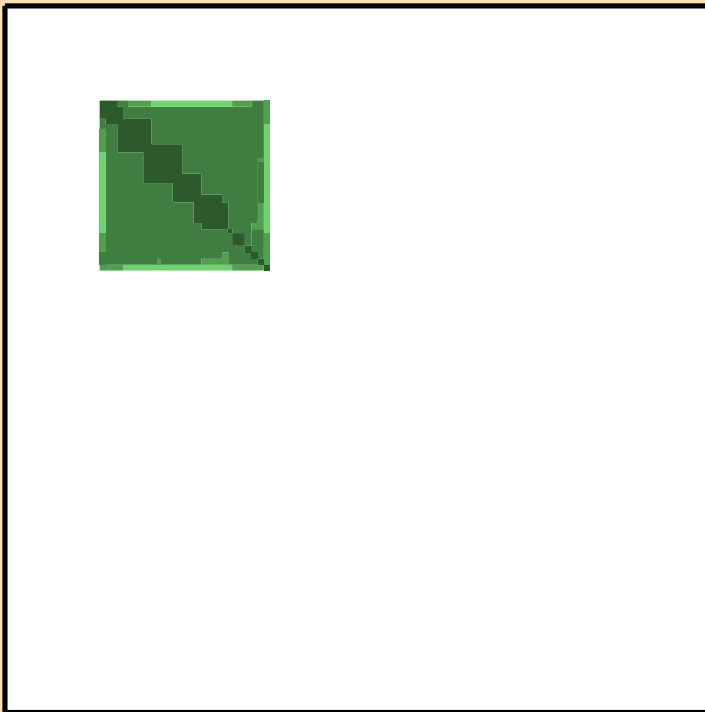


Correlation Matrix

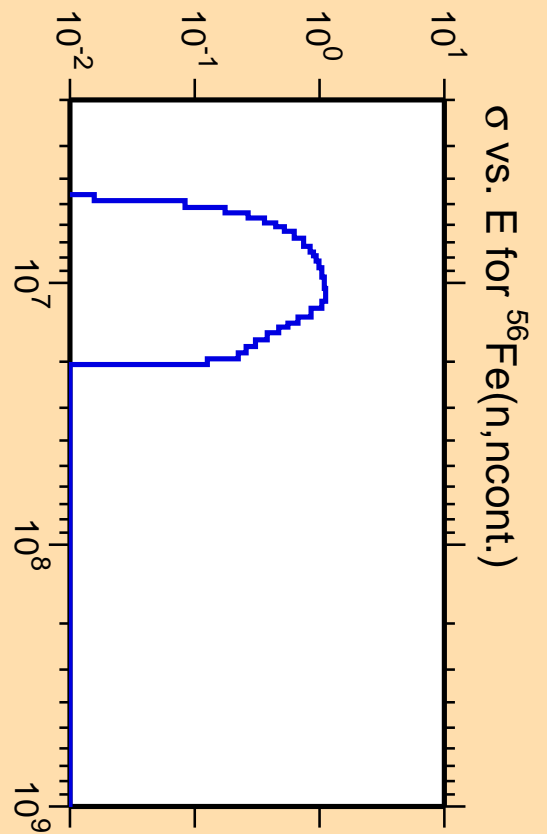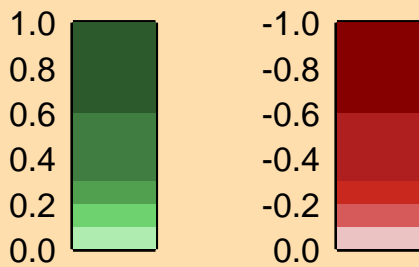

σ vs. E for $^{56}\text{Fe}(n,n\text{cont.})$


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\gamma)$

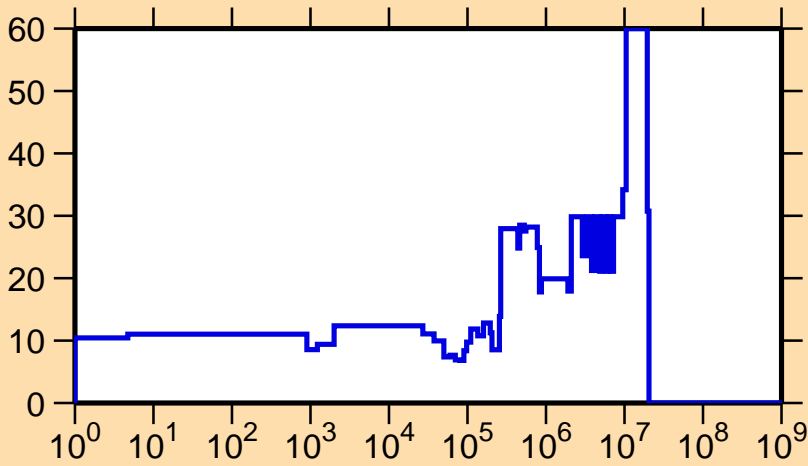



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

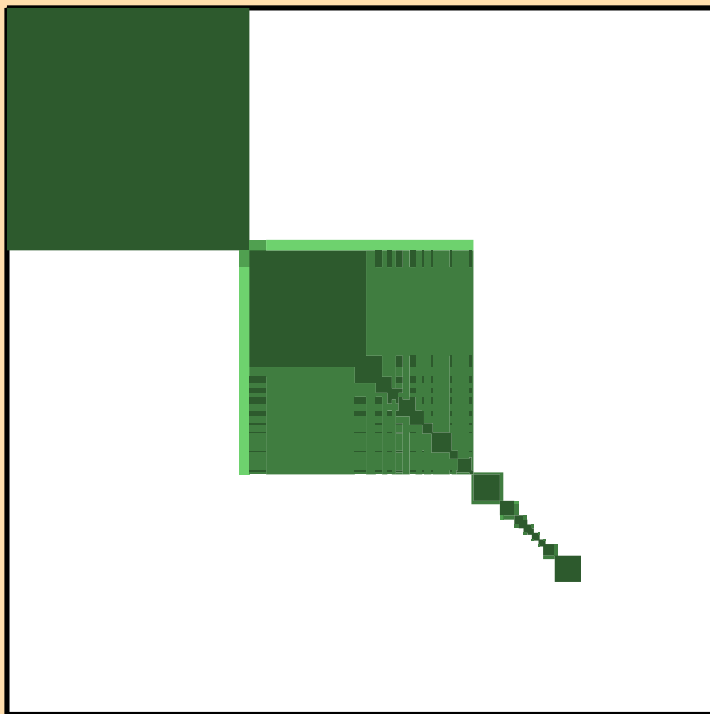

Correlation Matrix

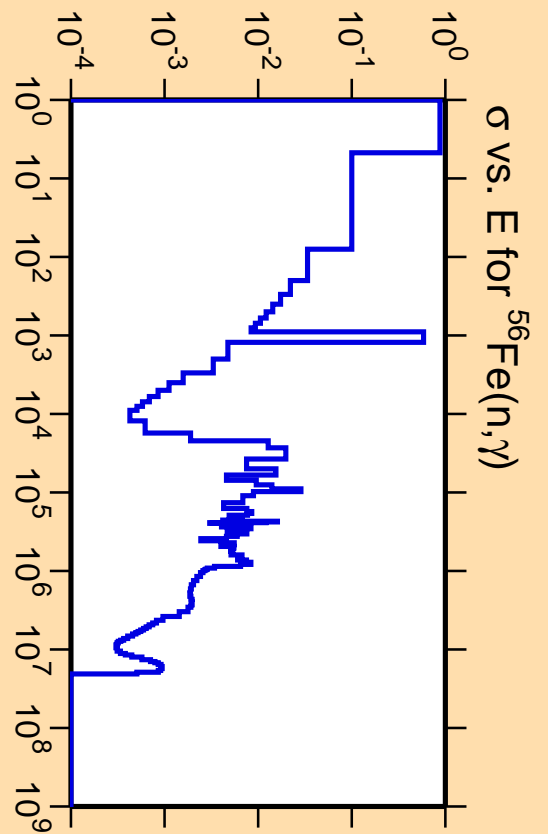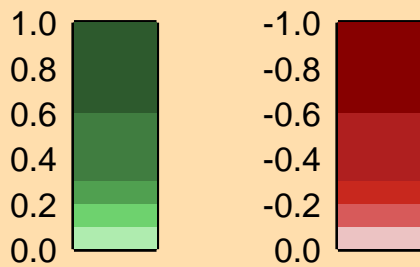


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,p)$


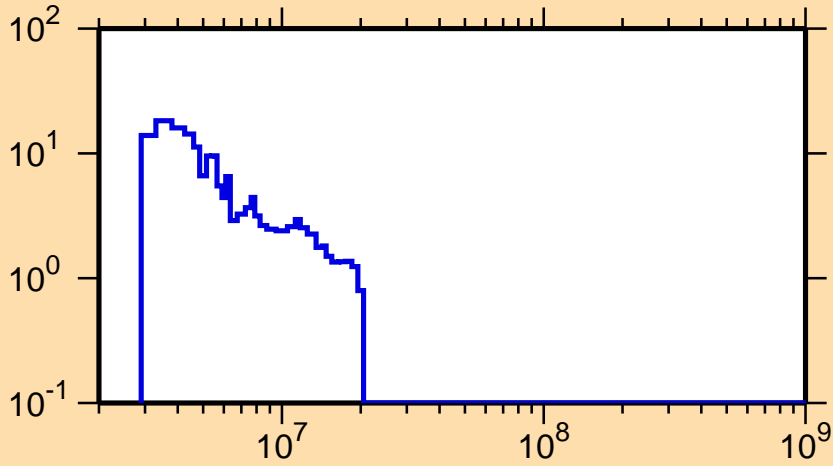


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

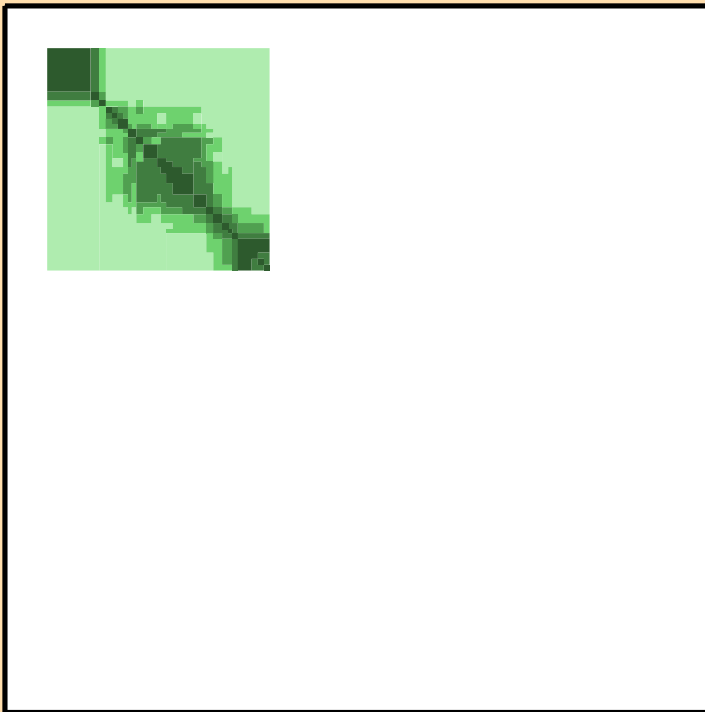

Correlation Matrix

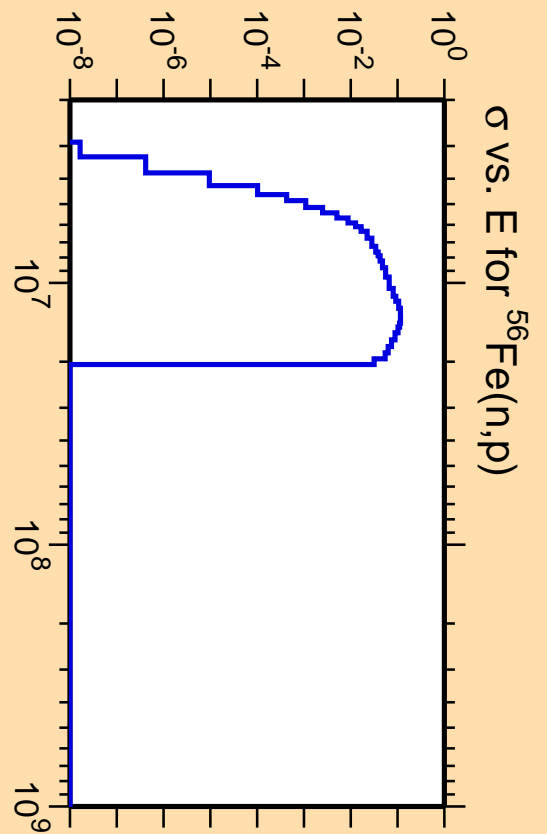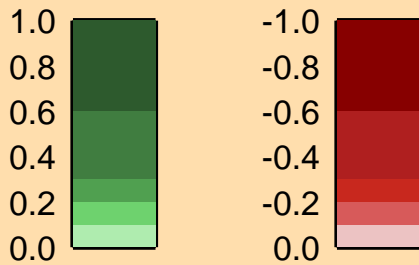

$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,d)$

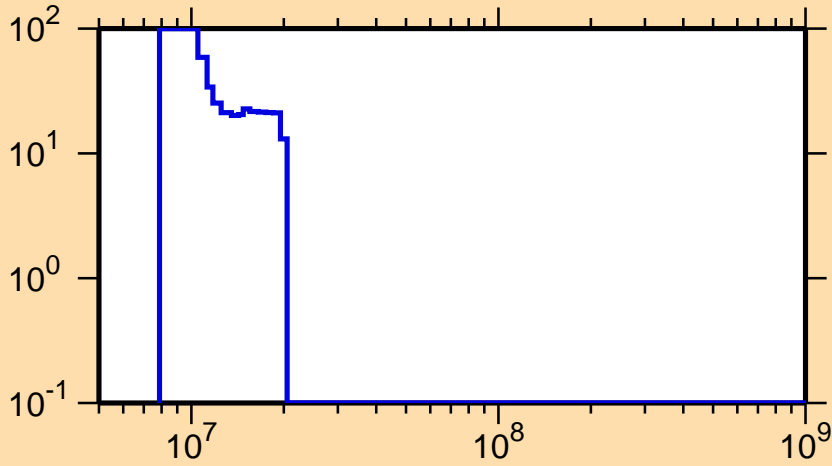



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

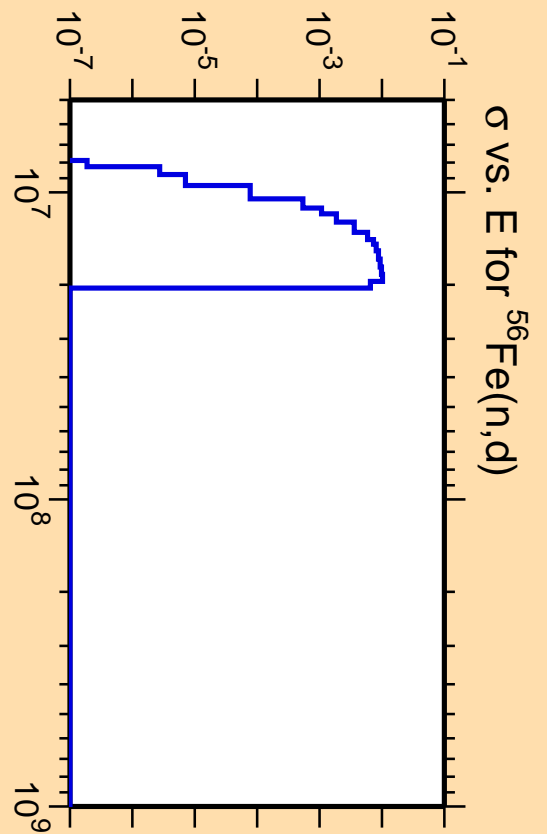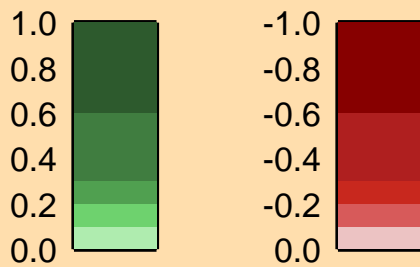


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,t)$

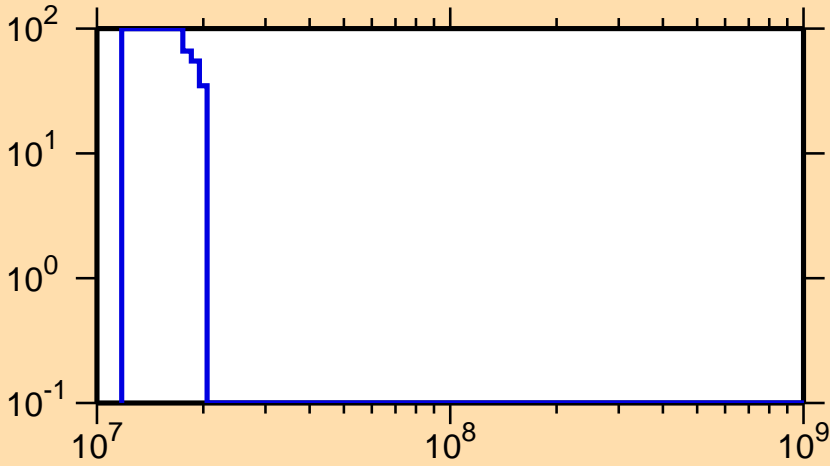



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

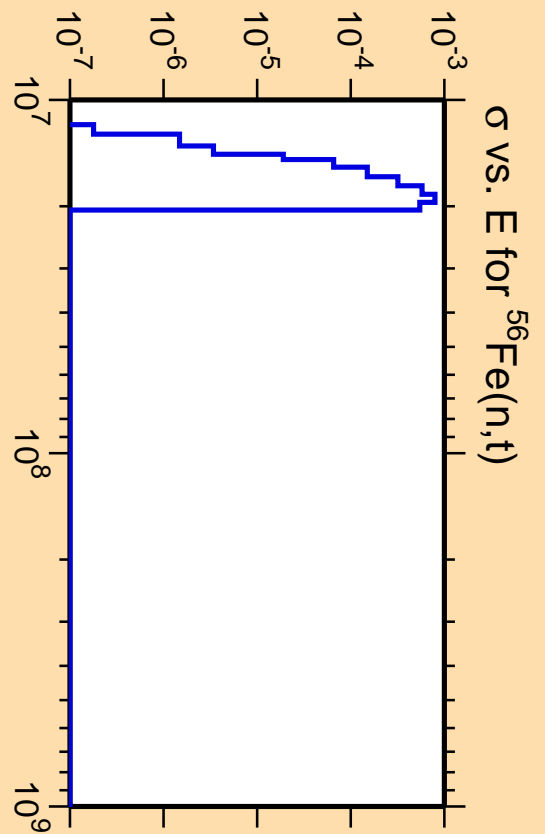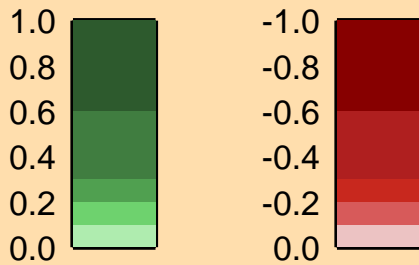


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\text{He}3)$

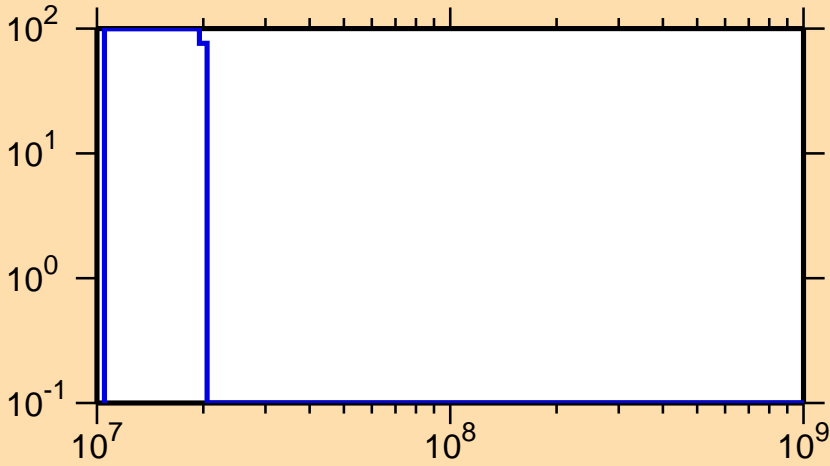



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.



Correlation Matrix

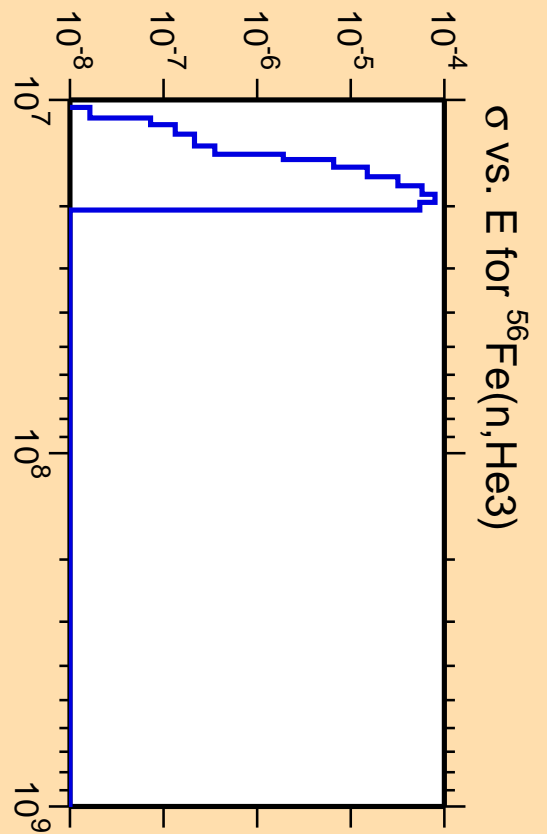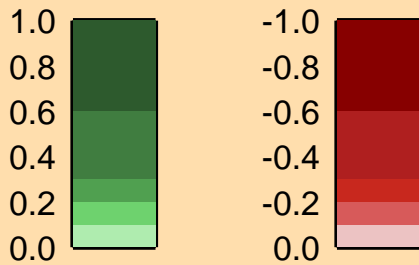


$\Delta\sigma/\sigma$ vs. E for $^{56}\text{Fe}(n,\alpha)$

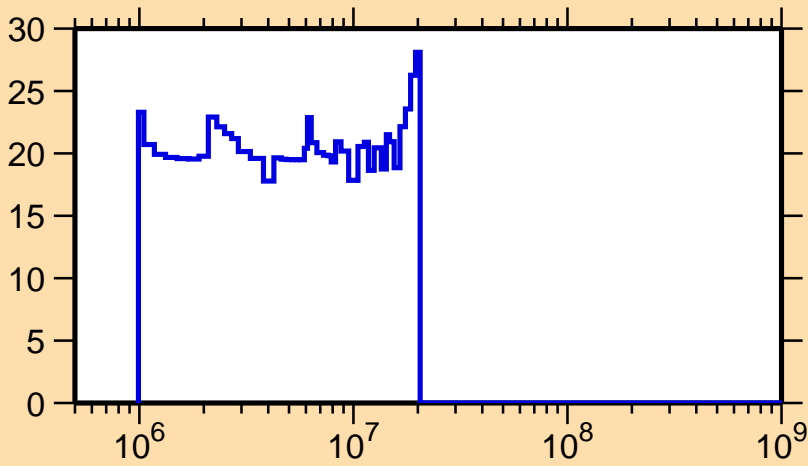

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

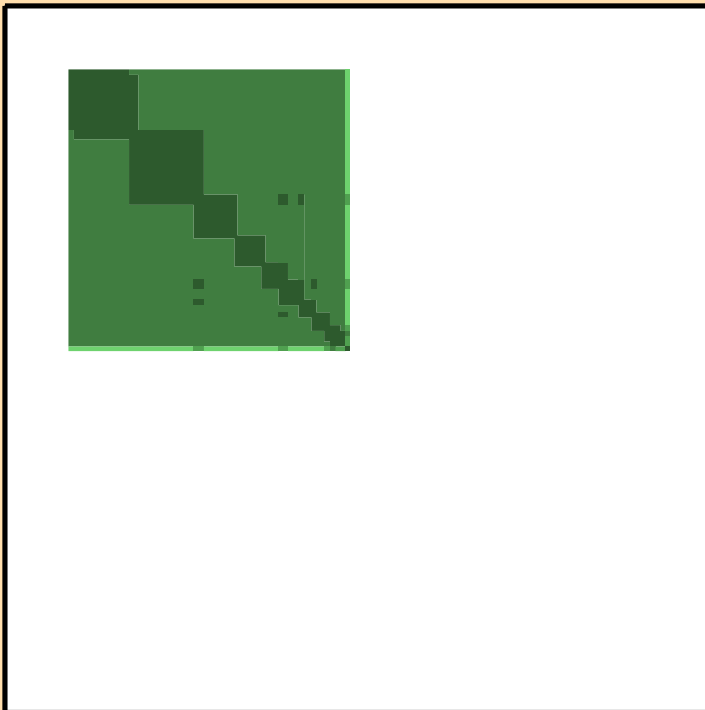

Correlation Matrix

